


Kugellager

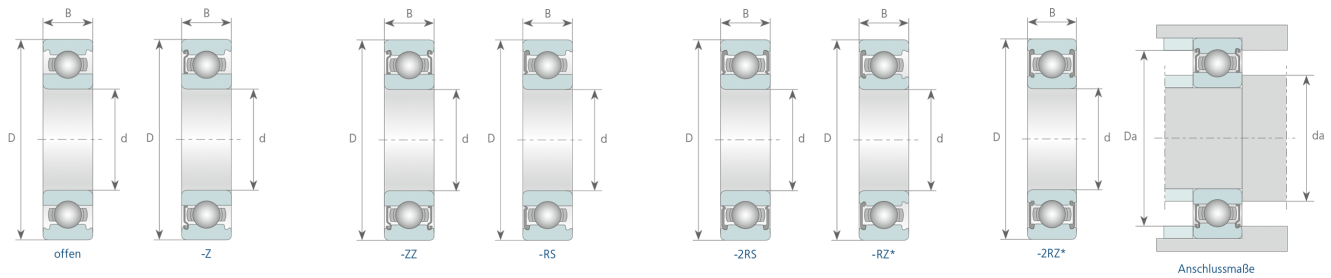

| Kurz-Zeichen | Haupt-Abmessungen [mm] | | | Trag-Zahlen [N] | | Grenz-Drehzahlen [min ⁻¹] | | Anschluss-Maße [mm] | | Gewicht [kg] |
|--------------|------------------------|----|-----|-----------------|-----------|---------------------------------------|-------|---------------------|--------|--------------|
| | d | D | B | dyn. Cr | stat. Cor | Fett | Öl | da min | Da max | |
| MR72-ZZ | 2 | 7 | 3,0 | 260 | 75 | 62000 | 0 | 0,0 | 0,0 | 0,00042 |
| MR72-2RS | 2 | 7 | 3,0 | 260 | 75 | 0 | 0 | 0,0 | 0,0 | 0,00042 |
| MR72 | 2 | 7 | 2,5 | 260 | 75 | 62000 | 74000 | 0,0 | 0,0 | 0,00042 |
| 623 | 3 | 10 | 4,0 | 650 | 220 | 53000 | 61000 | 4,4 | 8,6 | 0,00145 |
| MR83 | 3 | 8 | 2,5 | 377 | 110 | 53000 | 66000 | 0,0 | 0,0 | 0,00048 |
| MR83-2RS | 3 | 8 | 3,0 | 377 | 110 | 0 | 0 | 0,0 | 0,0 | 0,00048 |
| 623-ZZ | 3 | 10 | 4,0 | 650 | 220 | 53000 | 0 | 4,4 | 8,6 | 0,00145 |
| 623-2RS | 3 | 10 | 4,0 | 650 | 220 | 40000 | 0 | 4,4 | 8,6 | 0,00145 |
| MR93-2RS | 3 | 9 | 4,0 | 390 | 110 | 0 | 0 | 0,0 | 0,0 | 0,00075 |
| 683-ZZ | 3 | 7 | 3,0 | 208 | 60 | 61000 | 0 | 4,2 | 5,8 | 0,00032 |
| MR83-ZZ | 3 | 8 | 3,0 | 377 | 110 | 53000 | 0 | 0,0 | 0,0 | 0,00048 |
| MR93-ZZ | 3 | 9 | 4,0 | 390 | 110 | 53000 | 0 | 0,0 | 0,0 | 0,00075 |
| 683-2RS | 3 | 7 | 3,0 | 208 | 60 | 0 | 0 | 4,2 | 5,8 | 0,00032 |
| MR93 | 3 | 9 | 2,5 | 390 | 110 | 53000 | 62000 | 0,0 | 0,0 | 0,00075 |
| 683 | 3 | 7 | 2,0 | 208 | 60 | 61000 | 71000 | 4,2 | 5,8 | 0,00032 |
| 684-ZZ | 4 | 9 | 4,0 | 481 | 170 | 51000 | 0 | 5,2 | 7,8 | 0,00065 |
| MR84-ZZ | 4 | 8 | 3,0 | 260 | 80 | 55000 | 0 | 0,0 | 0,0 | 0,00039 |
| MR74-ZZ | 4 | 7 | 2,5 | 169 | 55 | 57000 | 0 | 0,0 | 0,0 | 0,00023 |
| 624-ZZ | 4 | 13 | 5,0 | 1326 | 490 | 44000 | 0 | 5,8 | 11,2 | 0,00310 |
| MR104-ZZ | 4 | 10 | 4,0 | 390 | 120 | 48000 | 0 | 0,0 | 0,0 | 0,00090 |
| 634 | 4 | 16 | 5,0 | 1365 | 500 | 39000 | 46200 | 6,4 | 13,6 | 0,00540 |
| MR104 | 4 | 10 | 3,0 | 390 | 120 | 48000 | 58000 | 0,0 | 0,0 | 0,00090 |
| 624-2RS | 4 | 13 | 4,0 | 1326 | 490 | 39000 | 0 | 5,8 | 11,2 | 0,00310 |
| MR74-2RS | 4 | 7 | 2,5 | 169 | 55 | 0 | 0 | 0,0 | 0,0 | 0,00023 |
| MR84 | 4 | 8 | 2,0 | 260 | 80 | 55000 | 64000 | 0,0 | 0,0 | 0,00039 |
| 694 | 4 | 11 | 4,0 | 728 | 260 | 47000 | 55000 | 5,2 | 9,8 | 0,00170 |
| MR74 | 4 | 7 | 2,0 | 169 | 55 | 57000 | 66000 | 0,0 | 0,0 | 0,00023 |
| 684 | 4 | 9 | 2,5 | 481 | 170 | 51000 | 60000 | 5,2 | 7,8 | 0,00065 |
| 694-2RS | 4 | 11 | 4,0 | 728 | 260 | 0 | 0 | 5,2 | 9,8 | 0,00170 |
| 684-2RS | 4 | 9 | 4,0 | 481 | 170 | 0 | 0 | 5,2 | 7,8 | 0,00065 |
| MR84-2RS | 4 | 8 | 3,0 | 260 | 80 | 0 | 0 | 0,0 | 0,0 | 0,00039 |
| MR104-2RS | 4 | 10 | 4,0 | 390 | 120 | 0 | 0 | 0,0 | 0,0 | 0,00090 |
| 694-ZZ | 4 | 11 | 4,0 | 728 | 260 | 47000 | 0 | 5,2 | 9,8 | 0,00170 |
| 624 | 4 | 13 | 5,0 | 1326 | 490 | 44000 | 51000 | 5,8 | 11,2 | 0,00310 |

Kugellager

| Kurz-Zeichen | Haupt-Abmessungen [mm] | | | Trag-Zahlen [N] | | Grenz-Drehzahlen [min-1] | | Anschluss-Maße [mm] | | Gewicht [kg] |
|--------------|------------------------|----|-----|-----------------|-----------|--------------------------|-------|---------------------|--------|--------------|
| | d | D | B | dyn. Cr | stat. Cor | Fett | Öl | da min | Da max | |
| 634-2RS | 4 | 16 | 5,0 | 1365 | 500 | 27000 | 0 | 6,4 | 13,6 | 0,00540 |
| 634-ZZ | 4 | 16 | 5,0 | 1365 | 500 | 39000 | 0 | 6,4 | 13,6 | 0,00540 |
| 605-2RS | 5 | 14 | 5,0 | 1352 | 500 | 0 | 0 | 6,6 | 12,4 | 0,00300 |
| MR85 | 5 | 8 | 2,0 | 182 | 65 | 51000 | 60000 | 0,0 | 0,0 | 0,00025 |
| MR95 | 5 | 9 | 2,5 | 286 | 90 | 48000 | 58000 | 0,0 | 0,0 | 0,00054 |
| 685-ZZ | 5 | 11 | 5,0 | 728 | 260 | 45000 | 0 | 6,2 | 9,8 | 0,00116 |
| MR105 | 5 | 10 | 3,0 | 286 | 90 | 47000 | 55000 | 0,0 | 0,0 | 0,00090 |
| MR95-ZZ | 5 | 9 | 3,0 | 286 | 90 | 48000 | 0 | 0,0 | 0,0 | 0,00054 |
| 635-ZZ | 5 | 19 | 6,0 | 2379 | 900 | 36000 | 0 | 7,4 | 16,6 | 0,00900 |
| 685-2RS | 5 | 11 | 5,0 | 728 | 260 | 0 | 0 | 6,2 | 9,8 | 0,00116 |
| MR95-2RS | 5 | 9 | 3,0 | 286 | 90 | 0 | 0 | 0,0 | 0,0 | 0,00054 |
| 685 | 5 | 11 | 3,0 | 728 | 260 | 45000 | 54000 | 6,2 | 9,8 | 0,00116 |
| 625-2RS | 5 | 16 | 5,0 | 1768 | 670 | 27000 | 0 | 7,4 | 13,6 | 0,00500 |
| 625-ZZ | 5 | 16 | 5,0 | 1768 | 670 | 39000 | 0 | 7,4 | 13,6 | 0,00500 |
| MR105-ZZ | 5 | 10 | 4,0 | 286 | 90 | 47000 | 0 | 0,0 | 0,0 | 0,00090 |
| 605-ZZ | 5 | 14 | 5,0 | 1352 | 500 | 41000 | 0 | 6,6 | 12,4 | 0,00300 |
| MR85-ZZ | 5 | 8 | 2,5 | 182 | 65 | 51000 | 0 | 0,0 | 0,0 | 0,00025 |
| MR105-2RS | 5 | 10 | 4,0 | 286 | 90 | 0 | 0 | 0,0 | 0,0 | 0,00090 |
| 635-2RS | 5 | 19 | 6,0 | 2379 | 900 | 21000 | 0 | 7,4 | 16,6 | 0,00900 |
| 635 | 5 | 19 | 6,0 | 2379 | 900 | 36000 | 42000 | 7,4 | 16,6 | 0,00900 |
| 695-2RS | 5 | 13 | 4,0 | 1105 | 410 | 0 | 0 | 6,6 | 11,4 | 0,00240 |
| 695-ZZ | 5 | 13 | 4,0 | 1105 | 410 | 42000 | 0 | 6,6 | 11,4 | 0,00240 |
| 695 | 5 | 13 | 4,0 | 1105 | 410 | 42000 | 49000 | 6,6 | 11,4 | 0,00240 |
| MR85-2RS | 5 | 8 | 2,5 | 182 | 65 | 0 | 0 | 0,0 | 0,0 | 0,00025 |
| 605 | 5 | 14 | 5,0 | 1352 | 500 | 41000 | 48000 | 6,6 | 12,4 | 0,00300 |
| 625 | 5 | 16 | 5,0 | 1768 | 670 | 39000 | 46000 | 7,4 | 13,6 | 0,00500 |
| MR106 | 6 | 10 | 2,5 | 338 | 120 | 45000 | 54000 | 0,0 | 0,0 | 0,00055 |
| MR126 | 6 | 12 | 3,0 | 481 | 160 | 42000 | 49000 | 0,0 | 0,0 | 0,00125 |
| MR126-2RS | 6 | 12 | 4,0 | 481 | 160 | 0 | 0 | 0,0 | 0,0 | 0,00125 |
| 696-2RS | 6 | 15 | 5,0 | 1365 | 500 | 0 | 0 | 7,6 | 13,4 | 0,00390 |
| 686-2RS | 6 | 13 | 5,0 | 1105 | 410 | 0 | 0 | 7,2 | 11,8 | 0,00187 |
| 696-ZZ | 6 | 15 | 5,0 | 1365 | 500 | 39000 | 0 | 7,6 | 13,4 | 0,00390 |
| 626 ** | 6 | 19 | 6,0 | 2288 | 860 | 36000 | 42000 | 8,4 | 16,6 | 0,00840 |
| 686-ZZ | 6 | 13 | 5,0 | 1105 | 410 | 41000 | 0 | 7,2 | 11,8 | 0,00187 |
| 626-ZZ ** | 6 | 19 | 6,0 | 2288 | 860 | 36000 | 0 | 8,4 | 16,6 | 0,00840 |
| 686 | 6 | 13 | 3,5 | 1105 | 410 | 41000 | 48000 | 7,2 | 11,8 | 0,00187 |
| MR106-2RS | 6 | 10 | 3,0 | 338 | 120 | 0 | 0 | 0,0 | 0,0 | 0,00055 |
| MR106-ZZ | 6 | 10 | 3,0 | 338 | 120 | 45000 | 0 | 0,0 | 0,0 | 0,00055 |
| 626-2RS ** | 6 | 19 | 6,0 | 2288 | 860 | 21000 | 0 | 8,4 | 16,6 | 0,00840 |
| MR126-ZZ | 6 | 12 | 4,0 | 481 | 160 | 42000 | 0 | 0,0 | 0,0 | 0,00125 |
| 696 | 6 | 15 | 5,0 | 1365 | 500 | 39000 | 46000 | 7,6 | 13,4 | 0,00390 |
| MR137 | 7 | 13 | 3,0 | 364 | 140 | 40000 | 47000 | 0,0 | 0,0 | 0,00150 |
| 687-ZZ | 7 | 14 | 5,0 | 1196 | 470 | 39000 | 0 | 8,2 | 12,8 | 0,00200 |
| MR137-ZZ | 7 | 13 | 4,0 | 364 | 140 | 40000 | 0 | 0,0 | 0,0 | 0,00150 |
| 627 ** | 7 | 22 | 7,0 | 3380 | 1320 | 34000 | 39000 | 9,4 | 19,6 | 0,01300 |

Kugellager

| Kurz-Zeichen | Haupt-Abmessungen [mm] | | | Trag-Zahlen [N] | | Grenz-Drehzahlen [min-1] | | Anschluss-Maße [mm] | | Gewicht [kg] |
|--------------|------------------------|----|------|-----------------|-----------|--------------------------|-------|---------------------|--------|--------------|
| | d | D | B | dyn. Cr | stat. Cor | Fett | Öl | da min | Da max | |
| MR117-ZZ | 7 | 11 | 3,0 | 312 | 100 | 42000 | 0 | 0,0 | 0,0 | 0,00070 |
| 607 ** | 7 | 19 | 6,0 | 2288 | 860 | 36000 | 42000 | 9,0 | 17,0 | 0,00750 |
| MR117-2RS | 7 | 11 | 3,0 | 312 | 100 | 0 | 0 | 0,0 | 0,0 | 0,00070 |
| 687 | 7 | 14 | 3,5 | 1196 | 470 | 39000 | 46000 | 8,2 | 12,8 | 0,00200 |
| MR117 | 7 | 11 | 2,5 | 312 | 100 | 42000 | 49000 | 0,0 | 0,0 | 0,00070 |
| SS-607-2RS | 7 | 19 | 6,0 | 2000 | 770 | 28000 | 0 | 9,0 | 17,0 | 0,00700 |
| 607-2RS ** | 7 | 19 | 6,0 | 2288 | 860 | 30000 | 0 | 9,0 | 17,0 | 0,00750 |
| 607-ZZ ** | 7 | 19 | 6,0 | 2288 | 860 | 36000 | 0 | 9,0 | 17,0 | 0,00750 |
| 687-2RS | 7 | 14 | 5,0 | 1196 | 470 | 0 | 0 | 8,2 | 12,8 | 0,00200 |
| 627-2RS ** | 7 | 22 | 7,0 | 3380 | 1320 | 29000 | 0 | 9,4 | 19,6 | 0,01300 |
| 627-ZZ ** | 7 | 22 | 7,0 | 3380 | 1320 | 34000 | 0 | 9,4 | 19,6 | 0,01300 |
| MR137-2RS | 7 | 13 | 4,0 | 364 | 140 | 0 | 0 | 0,0 | 0,0 | 0,00150 |
| 688 | 8 | 16 | 4,0 | 1274 | 530 | 37000 | 43000 | 9,6 | 14,4 | 0,00300 |
| 698-ZZ | 8 | 19 | 6,0 | 2240 | 870 | 36000 | 0 | 10,0 | 17,0 | 0,00705 |
| 608-2RS ** | 8 | 22 | 7,0 | 3380 | 1320 | 28000 | 0 | 10,0 | 20,0 | 0,01200 |
| SS-608-2RS | 8 | 22 | 7,0 | 3000 | 1200 | 26000 | 0 | 10,0 | 20,0 | 0,01200 |
| MR128 | 8 | 12 | 2,5 | 364 | 140 | 40000 | 47000 | 0,0 | 0,0 | 0,00070 |
| 698 | 8 | 19 | 6,0 | 2240 | 870 | 36000 | 43000 | 10,0 | 17,0 | 0,00705 |
| 628 ** | 8 | 24 | 8,0 | 3350 | 1410 | 33000 | 38000 | 10,4 | 21,6 | 0,01700 |
| MR128-ZZ | 8 | 12 | 3,5 | 364 | 140 | 40000 | 0 | 0,0 | 0,0 | 0,00070 |
| 628-ZZ ** | 8 | 24 | 8,0 | 3350 | 1410 | 33000 | 0 | 10,4 | 21,6 | 0,01700 |
| 608-ZZ ** | 8 | 22 | 7,0 | 3380 | 1320 | 34000 | 0 | 10,0 | 20,0 | 0,01200 |
| MR148 | 8 | 14 | 3,5 | 585 | 220 | 38000 | 45000 | 0,0 | 0,0 | 0,00190 |
| 688-ZZ | 8 | 16 | 5,0 | 1274 | 530 | 37000 | 0 | 9,6 | 14,4 | 0,00300 |
| MR148-ZZ | 8 | 14 | 4,0 | 585 | 220 | 38000 | 0 | 0,0 | 0,0 | 0,00190 |
| MR148-2RS | 8 | 14 | 4,0 | 585 | 220 | 0 | 0 | 0,0 | 0,0 | 0,00190 |
| 698-2RS | 8 | 19 | 6,0 | 2240 | 870 | 0 | 0 | 10,0 | 17,0 | 0,00705 |
| MR128-2RS | 8 | 12 | 3,5 | 364 | 140 | 0 | 0 | 0,0 | 0,0 | 0,00070 |
| 608 ** | 8 | 22 | 7,0 | 3380 | 1320 | 34000 | 39000 | 10,0 | 20,0 | 0,01200 |
| 628-2RS ** | 8 | 24 | 8,0 | 3350 | 1410 | 20000 | 0 | 10,4 | 21,6 | 0,01700 |
| 688-2RS | 8 | 16 | 5,0 | 1274 | 530 | 0 | 0 | 9,6 | 14,4 | 0,00300 |
| 689-ZZ | 9 | 17 | 5,0 | 1350 | 580 | 36000 | 0 | 10,6 | 15,4 | 0,00340 |
| 689 | 9 | 17 | 4,0 | 1350 | 580 | 36000 | 43000 | 10,6 | 15,4 | 0,00340 |
| 629-2RS ** | 9 | 26 | 8,0 | 4615 | 1816 | 27000 | 0 | 11,4 | 23,6 | 0,02000 |
| 629 ** | 9 | 26 | 8,0 | 4615 | 1816 | 32000 | 37000 | 11,4 | 23,6 | 0,02000 |
| SS-609-2RS | 9 | 24 | 7,0 | 3300 | 1400 | 25000 | 0 | 11,0 | 22,0 | 0,01400 |
| 609 ** | 9 | 24 | 7,0 | 3770 | 1560 | 33000 | 38000 | 11,0 | 22,0 | 0,01400 |
| 689-2RS | 9 | 17 | 5,0 | 1350 | 580 | 0 | 0 | 10,6 | 15,4 | 0,00340 |
| 609-2RS ** | 9 | 24 | 7,0 | 3770 | 1560 | 27500 | 0 | 11,0 | 22,0 | 0,01400 |
| 609-ZZ ** | 9 | 24 | 7,0 | 3770 | 1560 | 33000 | 0 | 11,0 | 22,0 | 0,01400 |
| 629-ZZ ** | 9 | 26 | 8,0 | 4615 | 1816 | 32000 | 0 | 11,4 | 23,6 | 0,02000 |
| 6200 ** | 10 | 30 | 9,0 | 5100 | 2400 | 26000 | 32000 | 14,2 | 25,8 | 0,03200 |
| 6300 ** | 10 | 35 | 11,0 | 8100 | 3450 | 20000 | 26000 | 14,2 | 30,8 | 0,05700 |
| SS-6000-2RS | 10 | 26 | 8,0 | 4100 | 1700 | 17000 | 0 | 12,0 | 24,0 | 0,01900 |
| SS-6800-2RS | 10 | 19 | 5,0 | 1460 | 740 | 22000 | 0 | 12,0 | 17,0 | 0,00500 |

Kugellager

| Kurz-Zeichen | Haupt-Abmessungen [mm] | | | Trag-Zahlen [N] | | Grenz-Drehzahlen [min-1] | | Anschluss-Maße [mm] | | Gewicht [kg] |
|--------------|------------------------|----|------|-----------------|-----------|--------------------------|-------|---------------------|--------|--------------|
| | d | D | B | dyn. Cr | stat. Cor | Fett | Öl | da min | Da max | |
| 6900 | 10 | 22 | 6,0 | 2700 | 1270 | 30000 | 36000 | 12,0 | 20,0 | 0,00900 |
| 6800-2RS | 10 | 19 | 5,0 | 1830 | 925 | 24000 | 0 | 12,0 | 17,0 | 0,00500 |
| 63000-2RS | 10 | 26 | 12,0 | 4200 | 1900 | 17500 | 0 | 12,0 | 24,0 | 0,03000 |
| 6800-ZZ | 10 | 19 | 5,0 | 1830 | 925 | 32000 | 0 | 12,0 | 17,0 | 0,00500 |
| 6200-ZZ ** | 10 | 30 | 9,0 | 5100 | 2400 | 26000 | 0 | 14,2 | 25,8 | 0,03200 |
| 6200-2RS ** | 10 | 30 | 9,0 | 5100 | 2400 | 17000 | 0 | 14,2 | 25,8 | 0,03200 |
| 6800 | 10 | 19 | 5,0 | 1830 | 925 | 32000 | 38000 | 12,0 | 17,0 | 0,00500 |
| 6000-ZZ ** | 10 | 26 | 8,0 | 4550 | 1950 | 28000 | 0 | 12,0 | 24,0 | 0,02000 |
| 6000 ** | 10 | 26 | 8,0 | 4550 | 1950 | 28000 | 34000 | 12,0 | 24,0 | 0,02000 |
| SS-6900-2RS | 10 | 22 | 6,0 | 2160 | 1000 | 19000 | 0 | 12,0 | 20,0 | 0,00900 |
| 62300-2RS | 10 | 35 | 17,0 | 7900 | 3100 | 13500 | 0 | 14,3 | 30,7 | 0,06000 |
| 6000-2RS ** | 10 | 26 | 8,0 | 4550 | 1950 | 17000 | 0 | 12,0 | 24,0 | 0,02000 |
| 62200-2RS | 10 | 30 | 14,0 | 5000 | 2150 | 16000 | 0 | 14,3 | 25,7 | 0,04000 |
| 6300-2RS ** | 10 | 35 | 11,0 | 8100 | 3450 | 14000 | 0 | 14,2 | 30,8 | 0,05700 |
| SS-6300-2RS | 10 | 35 | 11,0 | 7400 | 3100 | 13000 | 0 | 14,2 | 30,8 | 0,05300 |
| 6900-2RS | 10 | 22 | 6,0 | 2700 | 1270 | 21000 | 0 | 12,0 | 20,0 | 0,00900 |
| 6300-ZZ ** | 10 | 35 | 11,0 | 8100 | 3450 | 20000 | 0 | 14,2 | 30,8 | 0,05700 |
| SS-6200-2RS | 10 | 30 | 9,0 | 4600 | 2100 | 15000 | 0 | 14,2 | 25,8 | 0,03200 |
| 6900-ZZ | 10 | 22 | 6,0 | 2700 | 1270 | 30000 | 0 | 12,0 | 20,0 | 0,00900 |
| 6201-2RS ** | 12 | 32 | 10,0 | 6800 | 3050 | 15000 | 0 | 16,2 | 27,8 | 0,03700 |
| 6301-2RS ** | 12 | 37 | 12,0 | 9650 | 4150 | 12000 | 0 | 17,6 | 31,4 | 0,06500 |
| SS-6201-2RS | 12 | 32 | 10,0 | 5500 | 2500 | 13000 | 0 | 16,2 | 27,8 | 0,03700 |
| 6001-ZZ ** | 12 | 28 | 8,0 | 5100 | 2400 | 26000 | 0 | 14,0 | 26,0 | 0,02200 |
| 6801-ZZ | 12 | 21 | 5,0 | 1920 | 1040 | 29000 | 0 | 14,0 | 19,0 | 0,00600 |
| 6301 ** | 12 | 37 | 12,0 | 9650 | 4150 | 19000 | 24000 | 17,6 | 31,4 | 0,06500 |
| 6901-ZZ | 12 | 24 | 6,0 | 2890 | 1460 | 27000 | 0 | 14,0 | 22,0 | 0,01100 |
| SS-6801-2RS | 12 | 21 | 5,0 | 1530 | 830 | 18500 | 0 | 14,0 | 19,0 | 0,00600 |
| 6001-2RS ** | 12 | 28 | 8,0 | 5100 | 2400 | 17000 | 0 | 14,0 | 26,0 | 0,02200 |
| 62301-2RS | 12 | 37 | 17,0 | 9200 | 3900 | 13000 | 0 | 17,7 | 31,3 | 0,07000 |
| 62201-2RS | 12 | 32 | 14,0 | 6200 | 2900 | 13500 | 0 | 16,2 | 27,7 | 0,04500 |
| 63001-2RS | 12 | 28 | 12,0 | 5000 | 2150 | 16000 | 0 | 14,1 | 25,9 | 0,03000 |
| 6001 ** | 12 | 28 | 8,0 | 5100 | 2400 | 26000 | 32000 | 14,0 | 26,0 | 0,02200 |
| 6901 | 12 | 24 | 6,0 | 2890 | 1460 | 27000 | 32000 | 14,0 | 22,0 | 0,01100 |
| 6201-ZZ ** | 12 | 32 | 10,0 | 6800 | 3050 | 22000 | 0 | 16,2 | 27,8 | 0,03700 |
| 6301-ZZ ** | 12 | 37 | 12,0 | 9650 | 4150 | 19000 | 0 | 17,6 | 31,4 | 0,06500 |
| SS-6901-2RS | 12 | 24 | 6,0 | 2310 | 1160 | 17500 | 0 | 14,0 | 22,0 | 0,01100 |
| 6201 ** | 12 | 32 | 10,0 | 6800 | 3050 | 22000 | 28000 | 16,2 | 27,8 | 0,03700 |
| SS-6001-2RS | 12 | 28 | 8,0 | 4600 | 2100 | 15000 | 0 | 14,0 | 26,0 | 0,02200 |
| 6801 | 12 | 21 | 5,0 | 1920 | 1040 | 29000 | 35000 | 14,0 | 19,0 | 0,00600 |
| 6801-2RS | 12 | 21 | 5,0 | 1920 | 1040 | 20000 | 0 | 14,0 | 19,0 | 0,00600 |
| SS-6301-2RS | 12 | 37 | 12,0 | 8700 | 3800 | 12000 | 0 | 17,6 | 31,4 | 0,06000 |
| 6901-2RS | 12 | 24 | 6,0 | 2890 | 1460 | 19000 | 0 | 14,0 | 22,0 | 0,01100 |
| 6902-ZZ | 15 | 28 | 7,0 | 4100 | 2060 | 24000 | 0 | 17,0 | 26,0 | 0,01600 |
| SS-6902-2RS | 15 | 28 | 7,0 | 3280 | 1640 | 14500 | 0 | 17,0 | 26,0 | 0,01600 |
| 16002-2RS | 15 | 32 | 8,0 | 5600 | 2830 | 0 | 0 | 17,0 | 30,0 | 0,02500 |

Kugellager

| Kurz-Zeichen | Haupt-Abmessungen [mm] | | | Trag-Zahlen [N] | | Grenz-Drehzahlen [min-1] | | Anschluss-Maße [mm] | | Gewicht [kg] |
|--------------|------------------------|----|------|-----------------|-----------|--------------------------|-------|---------------------|--------|--------------|
| | d | D | B | dyn. Cr | stat. Cor | Fett | Öl | da min | Da max | |
| 6302 ** | 15 | 42 | 13,0 | 11400 | 5450 | 17000 | 20000 | 20,6 | 36,4 | 0,09200 |
| 6902-2RS | 15 | 28 | 7,0 | 4100 | 2060 | 16000 | 0 | 17,0 | 26,0 | 0,01600 |
| 63002-2RS | 15 | 32 | 13,0 | 5200 | 2400 | 13000 | 0 | 17,1 | 30,0 | 0,04000 |
| 6002 ** | 15 | 32 | 9,0 | 5600 | 2850 | 22000 | 28000 | 17,0 | 30,0 | 0,03100 |
| SS-6202-2RS | 15 | 35 | 11,0 | 6900 | 3200 | 12000 | 0 | 19,2 | 30,8 | 0,04500 |
| 6302-ZZ ** | 15 | 42 | 13,0 | 11400 | 5450 | 17000 | 0 | 20,6 | 36,4 | 0,09200 |
| 6302-2RS ** | 15 | 42 | 13,0 | 11400 | 5450 | 11000 | 0 | 20,6 | 36,4 | 0,09200 |
| 62202-2RS | 15 | 35 | 14,0 | 7100 | 3100 | 11900 | 0 | 19,2 | 30,7 | 0,05500 |
| 16002-ZZ | 15 | 32 | 8,0 | 5600 | 2830 | 22000 | 0 | 17,0 | 30,0 | 0,02500 |
| 6802-2RS | 15 | 24 | 5,0 | 2080 | 1260 | 17000 | 0 | 17,0 | 22,0 | 0,00700 |
| 6002-ZZ ** | 15 | 32 | 9,0 | 5600 | 2850 | 22000 | 0 | 17,0 | 30,0 | 0,03100 |
| 6002-2RS ** | 15 | 32 | 9,0 | 5600 | 2850 | 14000 | 0 | 17,0 | 30,0 | 0,03100 |
| SS-6302-2RS | 15 | 42 | 13,0 | 10200 | 4900 | 10000 | 0 | 20,6 | 36,4 | 0,08200 |
| 6202-2RS ** | 15 | 35 | 11,0 | 7650 | 3750 | 13000 | 0 | 19,2 | 30,8 | 0,04600 |
| 62302-2RS | 15 | 42 | 17,0 | 11300 | 5200 | 11000 | 0 | 20,7 | 36,5 | 0,11500 |
| 6902 | 15 | 28 | 7,0 | 4100 | 2060 | 24000 | 28000 | 17,0 | 26,0 | 0,01600 |
| 6802 | 15 | 24 | 5,0 | 2080 | 1260 | 26000 | 31000 | 17,0 | 22,0 | 0,00700 |
| SS-6802-2RS | 15 | 24 | 5,0 | 1660 | 1000 | 15000 | 0 | 17,0 | 22,0 | 0,00700 |
| 6202-ZZ ** | 15 | 35 | 11,0 | 7650 | 3750 | 19000 | 0 | 19,2 | 30,8 | 0,04600 |
| 6802-ZZ | 15 | 24 | 5,0 | 2080 | 1260 | 26000 | 0 | 17,0 | 22,0 | 0,00700 |
| 16002 | 15 | 32 | 8,0 | 5600 | 2830 | 22000 | 26000 | 17,0 | 30,0 | 0,02500 |
| SS-6002-2RS | 15 | 32 | 9,0 | 5000 | 2500 | 12000 | 0 | 17,0 | 30,0 | 0,03000 |
| 6202 ** | 15 | 35 | 11,0 | 7650 | 3750 | 19000 | 24000 | 19,2 | 30,8 | 0,04600 |
| 6903 | 17 | 30 | 7,0 | 4650 | 2580 | 22000 | 26000 | 19,0 | 28,0 | 0,01800 |
| SS-6303-2RS | 17 | 47 | 14,0 | 12100 | 5900 | 9000 | 0 | 22,6 | 41,4 | 0,11500 |
| 6303 ** | 17 | 47 | 14,0 | 13500 | 6550 | 16000 | 19000 | 22,6 | 41,4 | 0,12000 |
| 63003-2RS | 17 | 35 | 14,0 | 5800 | 2900 | 11800 | 0 | 19,0 | 33,0 | 0,05300 |
| 6803-2RS | 17 | 26 | 5,0 | 2200 | 1400 | 15000 | 0 | 19,0 | 24,0 | 0,00800 |
| 6303-ZZ ** | 17 | 47 | 14,0 | 13500 | 6550 | 16000 | 0 | 22,6 | 41,4 | 0,12000 |
| 6903-ZZ | 17 | 30 | 7,0 | 4650 | 2580 | 22000 | 0 | 19,0 | 28,0 | 0,01800 |
| 6003-ZZ ** | 17 | 35 | 10,0 | 6800 | 3250 | 20000 | 0 | 19,0 | 33,0 | 0,04200 |
| 62303-2RS | 17 | 47 | 19,0 | 13200 | 6500 | 10500 | 0 | 22,5 | 41,5 | 0,15500 |
| SS-6903-2RS | 17 | 30 | 7,0 | 3720 | 2060 | 12000 | 0 | 19,0 | 28,0 | 0,01800 |
| 6303-2RS ** | 17 | 47 | 14,0 | 13500 | 6550 | 11000 | 0 | 22,6 | 41,4 | 0,12000 |
| 6403 | 17 | 62 | 17,0 | 22500 | 11000 | 12000 | 15000 | 26,0 | 53,0 | 0,28500 |
| 6803-ZZ | 17 | 26 | 5,0 | 2200 | 1400 | 24000 | 0 | 19,0 | 24,0 | 0,00800 |
| SS-6803-2RS | 17 | 26 | 5,0 | 1760 | 1120 | 13000 | 0 | 19,0 | 24,0 | 0,00800 |
| 16003-ZZ | 17 | 35 | 8,0 | 6800 | 3250 | 20000 | 0 | 19,0 | 33,0 | 0,03200 |
| 6003 ** | 17 | 35 | 10,0 | 6800 | 3250 | 20000 | 26000 | 19,0 | 33,0 | 0,04200 |
| 6203 ** | 17 | 40 | 12,0 | 9550 | 4800 | 17000 | 20000 | 21,2 | 35,8 | 0,07000 |
| 6803 | 17 | 26 | 5,0 | 2200 | 1400 | 24000 | 28000 | 19,0 | 24,0 | 0,00800 |
| 16003 | 17 | 35 | 8,0 | 6800 | 3250 | 20000 | 26000 | 19,0 | 33,0 | 0,03200 |
| 6003-2RS ** | 17 | 35 | 10,0 | 6800 | 3250 | 12000 | 0 | 19,0 | 33,0 | 0,04200 |
| SS-6203-2RS | 17 | 40 | 12,0 | 8600 | 4100 | 10000 | 0 | 21,2 | 35,8 | 0,06600 |
| 16003-2RS | 17 | 35 | 8,0 | 6800 | 3250 | 0 | 0 | 19,0 | 33,0 | 0,03200 |

Kugellager

| Kurz-Zeichen | Haupt-Abmessungen [mm] | | | Trag-Zahlen [N] | | Grenz-Drehzahlen [min-1] | | Anschluss-Maße [mm] | | Gewicht [kg] |
|--------------|------------------------|----|------|-----------------|-----------|--------------------------|-------|---------------------|--------|--------------|
| | d | D | B | dyn. Cr | stat. Cor | Fett | Öl | da min | Da max | |
| 6903-2RS | 17 | 30 | 7,0 | 4650 | 2580 | 14000 | 0 | 19,0 | 28,0 | 0,01800 |
| 6203-ZZ ** | 17 | 40 | 12,0 | 9550 | 4800 | 17000 | 0 | 21,2 | 35,8 | 0,07000 |
| 6203-2RS ** | 17 | 40 | 12,0 | 9550 | 4800 | 11000 | 0 | 21,2 | 35,8 | 0,07000 |
| 62203-2RS | 17 | 40 | 16,0 | 9300 | 4500 | 11000 | 0 | 21,3 | 35,7 | 0,08800 |
| SS-6003-2RS | 17 | 35 | 10,0 | 6100 | 3000 | 11000 | 0 | 19,0 | 33,0 | 0,03900 |
| 6904-ZZ | 20 | 37 | 9,0 | 6400 | 3700 | 19000 | 0 | 22,0 | 35,0 | 0,03600 |
| 6804-ZZ | 20 | 32 | 7,0 | 3450 | 2250 | 21000 | 0 | 22,0 | 30,0 | 0,01900 |
| 6804-2RS | 20 | 32 | 7,0 | 3450 | 2250 | 13000 | 0 | 22,0 | 30,0 | 0,01900 |
| 6004-ZZ ** | 20 | 42 | 12,0 | 9500 | 5050 | 17000 | 0 | 23,2 | 38,8 | 0,07000 |
| SS-6204-2RS | 20 | 47 | 14,0 | 11500 | 6000 | 8000 | 0 | 25,6 | 41,4 | 0,10600 |
| 6004 ** | 20 | 42 | 12,0 | 9500 | 5050 | 17000 | 20000 | 23,2 | 38,8 | 0,07000 |
| SS-6904-2RS | 20 | 37 | 9,0 | 5120 | 2960 | 10500 | 0 | 22,0 | 35,0 | 0,03600 |
| 6004-2RS ** | 20 | 42 | 12,0 | 9500 | 5050 | 11000 | 0 | 23,2 | 38,8 | 0,07000 |
| 16004 | 20 | 42 | 8,0 | 7950 | 4300 | 17000 | 20000 | 22,0 | 40,0 | 0,05000 |
| 62304-2RS | 20 | 52 | 21,0 | 15500 | 7500 | 9000 | 0 | 27,1 | 45,0 | 0,20900 |
| 63004-2RS | 20 | 42 | 16,0 | 8800 | 4600 | 10200 | 0 | 23,4 | 38,8 | 0,08800 |
| 6904-2RS | 20 | 37 | 9,0 | 6400 | 3700 | 12000 | 0 | 22,0 | 35,0 | 0,03600 |
| 6204-ZZ ** | 20 | 47 | 14,0 | 12800 | 6650 | 15000 | 0 | 25,6 | 41,4 | 0,11800 |
| 6304-ZZ ** | 20 | 52 | 15,0 | 15900 | 7900 | 13000 | 0 | 27,0 | 45,0 | 0,15800 |
| 16004-ZZ | 20 | 42 | 8,0 | 7950 | 4300 | 17000 | 0 | 22,0 | 40,0 | 0,05000 |
| 6204-2RS ** | 20 | 47 | 14,0 | 12800 | 6650 | 10000 | 0 | 25,6 | 41,4 | 0,11800 |
| SS-6004-2RS | 20 | 42 | 12,0 | 8400 | 4500 | 9000 | 0 | 23,2 | 38,8 | 0,06900 |
| SS-6804-2RS | 20 | 32 | 7,0 | 2760 | 1800 | 11200 | 0 | 22,0 | 30,0 | 0,01900 |
| 6804 | 20 | 32 | 7,0 | 3450 | 2250 | 21000 | 25000 | 22,0 | 30,0 | 0,01900 |
| 16004-2RS | 20 | 42 | 8,0 | 7950 | 4300 | 0 | 0 | 22,0 | 40,0 | 0,05000 |
| SS-6304-2RS | 20 | 52 | 15,0 | 14300 | 7100 | 8000 | 0 | 27,0 | 45,0 | 0,14400 |
| 6304-2RS ** | 20 | 52 | 15,0 | 15900 | 7900 | 8000 | 0 | 27,0 | 45,0 | 0,15800 |
| 6904 | 20 | 37 | 9,0 | 6400 | 3700 | 19000 | 23000 | 22,0 | 35,0 | 0,03600 |
| 6204 ** | 20 | 47 | 14,0 | 12800 | 6650 | 15000 | 18000 | 25,6 | 41,4 | 0,11800 |
| 6304 ** | 20 | 52 | 15,0 | 15900 | 7900 | 13000 | 16000 | 27,0 | 45,0 | 0,15800 |
| 6404 | 20 | 72 | 19,0 | 31000 | 15200 | 10000 | 13000 | 27,0 | 65,0 | 0,12000 |
| 62204-2RS | 20 | 47 | 18,0 | 12000 | 6500 | 9500 | 0 | 25,7 | 41,3 | 0,13900 |
| 62205-2RS | 25 | 52 | 18,0 | 13800 | 7700 | 9000 | 0 | 30,6 | 46,4 | 0,15600 |
| 6205-2RS ** | 25 | 52 | 15,0 | 14000 | 7850 | 8000 | 0 | 30,6 | 46,4 | 0,14200 |
| 6005-ZZ ** | 25 | 47 | 12,0 | 10100 | 5850 | 15000 | 0 | 28,2 | 43,8 | 0,08600 |
| 6305-2RS ** | 25 | 62 | 17,0 | 20600 | 11300 | 7500 | 0 | 32,0 | 55,0 | 0,25000 |
| 6205-ZZ ** | 25 | 52 | 15,0 | 14000 | 7850 | 12000 | 0 | 30,6 | 46,4 | 0,14200 |
| SS-6905-2RS | 25 | 42 | 9,0 | 5640 | 3640 | 8400 | 0 | 27,0 | 40,0 | 0,04200 |
| 6905 | 25 | 42 | 9,0 | 7050 | 4550 | 16000 | 19000 | 27,0 | 40,0 | 0,04200 |
| 6805 | 25 | 37 | 7,0 | 4300 | 2600 | 18000 | 21000 | 27,0 | 35,0 | 0,02200 |
| 6005 ** | 25 | 47 | 12,0 | 10100 | 5850 | 15000 | 18000 | 28,2 | 43,8 | 0,08600 |
| 6405 | 25 | 80 | 21,0 | 37000 | 18800 | 9000 | 11000 | 36,0 | 71,0 | 0,57500 |
| SS-6005-2RS | 25 | 47 | 12,0 | 9000 | 5200 | 7500 | 0 | 28,2 | 43,8 | 0,08000 |
| SS-6205-2RS | 25 | 52 | 15,0 | 12600 | 7000 | 7000 | 0 | 30,6 | 46,4 | 0,12800 |
| 63005-2RS | 25 | 47 | 16,0 | 10500 | 6000 | 9100 | 0 | 29,3 | 43,7 | 0,10500 |

Kugellager

| Kurz-Zeichen | Haupt-Abmessungen [mm] | | | Trag-Zahlen [N] | | Grenz-Drehzahlen [min-1] | | Anschluss-Maße [mm] | | Gewicht [kg] |
|--------------|------------------------|----|------|-----------------|-----------|--------------------------|-------|---------------------|--------|--------------|
| | d | D | B | dyn. Cr | stat. Cor | Fett | Öl | da min | Da max | |
| 16005-ZZ | 25 | 47 | 8,0 | 8400 | 5100 | 15000 | 0 | 27,0 | 45,0 | 0,05800 |
| 6805-2RS | 25 | 37 | 7,0 | 4300 | 2600 | 10000 | 0 | 27,0 | 35,0 | 0,02200 |
| 16005 | 25 | 47 | 8,0 | 8400 | 5100 | 15000 | 18000 | 27,0 | 45,0 | 0,05800 |
| SS-6805-2RS | 25 | 37 | 7,0 | 3440 | 2080 | 8500 | 0 | 27,0 | 35,0 | 0,02200 |
| 6305 ** | 25 | 62 | 17,0 | 20600 | 11300 | 11000 | 14000 | 32,0 | 55,0 | 0,25000 |
| SS-6305-2RS | 25 | 62 | 17,0 | 19000 | 9800 | 6500 | 0 | 32,0 | 55,0 | 0,23200 |
| 6905-ZZ | 25 | 42 | 9,0 | 7050 | 4550 | 16000 | 0 | 27,0 | 40,0 | 0,04200 |
| 6005-2RS ** | 25 | 47 | 12,0 | 10100 | 5850 | 9500 | 0 | 28,2 | 43,8 | 0,08600 |
| 6805-ZZ | 25 | 37 | 7,0 | 4300 | 2600 | 18000 | 0 | 27,0 | 35,0 | 0,02200 |
| 6205 ** | 25 | 52 | 15,0 | 14000 | 7850 | 12000 | 15000 | 30,6 | 46,4 | 0,14200 |
| 62305-2RS | 25 | 62 | 24,0 | 22000 | 11000 | 7300 | 0 | 32,0 | 55,0 | 0,27200 |
| 6305-ZZ ** | 25 | 62 | 17,0 | 20600 | 11300 | 11000 | 0 | 32,0 | 55,0 | 0,25000 |
| 6905-2RS | 25 | 42 | 9,0 | 7050 | 4550 | 9800 | 0 | 27,0 | 40,0 | 0,04200 |
| 16005-2RS | 25 | 47 | 8,0 | 8400 | 5100 | 0 | 0 | 27,0 | 45,0 | 0,05800 |
| 6906-2RS | 30 | 47 | 9,0 | 7250 | 5000 | 8400 | 0 | 32,0 | 45,0 | 0,04800 |
| 6806-2RS | 30 | 42 | 7,0 | 4400 | 2900 | 8800 | 0 | 32,0 | 40,0 | 0,02600 |
| 16006 | 30 | 55 | 9,0 | 11200 | 7350 | 12000 | 15000 | 32,0 | 53,0 | 0,08700 |
| 6206-ZZ ** | 30 | 62 | 16,0 | 19500 | 11300 | 10000 | 0 | 35,6 | 56,4 | 0,21000 |
| 6406 | 30 | 90 | 23,0 | 47300 | 24500 | 8500 | 10000 | 39,0 | 81,0 | 0,78500 |
| 62206-2RS | 30 | 62 | 20,0 | 19000 | 11000 | 7300 | 0 | 35,7 | 56,2 | 0,24500 |
| 6006 ** | 30 | 55 | 13,0 | 13200 | 8250 | 12000 | 15000 | 34,6 | 50,4 | 0,12900 |
| 16006-ZZ | 30 | 55 | 9,0 | 11200 | 7350 | 12000 | 0 | 32,0 | 53,0 | 0,08700 |
| 6006-ZZ ** | 30 | 55 | 13,0 | 13200 | 8250 | 12000 | 0 | 34,6 | 50,4 | 0,12900 |
| 6206 ** | 30 | 62 | 16,0 | 19500 | 11300 | 10000 | 13000 | 35,6 | 56,4 | 0,21000 |
| 6006-2RS ** | 30 | 55 | 13,0 | 13200 | 8250 | 7500 | 0 | 34,6 | 50,4 | 0,12900 |
| 6206-2RS ** | 30 | 62 | 16,0 | 19500 | 11300 | 7000 | 0 | 35,6 | 56,4 | 0,21000 |
| SS-6306-2RS | 30 | 72 | 19,0 | 24000 | 13500 | 5500 | 0 | 37,0 | 65,0 | 0,36000 |
| 16006-2RS | 30 | 55 | 9,0 | 11200 | 7350 | 0 | 0 | 32,0 | 53,0 | 0,08700 |
| 6806 | 30 | 42 | 7,0 | 4400 | 2900 | 15000 | 18000 | 32,0 | 40,0 | 0,02600 |
| 6906 | 30 | 47 | 9,0 | 7250 | 5000 | 14000 | 17000 | 32,0 | 45,0 | 0,04800 |
| 6906-ZZ | 30 | 47 | 9,0 | 7250 | 5000 | 14000 | 0 | 32,0 | 45,0 | 0,04800 |
| SS-6806-2RS | 30 | 42 | 7,0 | 3520 | 2320 | 7500 | 0 | 32,0 | 40,0 | 0,02600 |
| 6806-ZZ | 30 | 42 | 7,0 | 4400 | 2900 | 15000 | 0 | 32,0 | 40,0 | 0,02600 |
| SS-6006-2RS | 30 | 55 | 13,0 | 11900 | 7500 | 6000 | 0 | 34,6 | 50,4 | 0,12000 |
| 62306-2RS | 30 | 72 | 27,0 | 28500 | 16000 | 6100 | 0 | 37,0 | 65,0 | 0,50000 |
| SS-6906-2RS | 30 | 47 | 9,0 | 5800 | 4000 | 7200 | 0 | 32,0 | 45,0 | 0,04800 |
| 6306-ZZ ** | 30 | 72 | 19,0 | 29900 | 15800 | 9000 | 0 | 37,0 | 65,0 | 0,37100 |
| 6306-2RS ** | 30 | 72 | 19,0 | 29900 | 15800 | 6000 | 0 | 37,0 | 65,0 | 0,37100 |
| SS-6206-2RS | 30 | 62 | 16,0 | 17500 | 10100 | 5800 | 0 | 35,6 | 56,4 | 0,19900 |
| 63006-2RS | 30 | 55 | 19,0 | 12500 | 7800 | 7600 | 0 | 34,6 | 50,3 | 0,16500 |
| 6306 ** | 30 | 72 | 19,0 | 29900 | 15800 | 9000 | 11000 | 37,0 | 65,0 | 0,37100 |
| SS-6007-2RS | 35 | 62 | 14,0 | 14400 | 9300 | 5000 | 0 | 39,6 | 57,4 | 0,16000 |
| 6907-2RS | 35 | 55 | 10,0 | 11200 | 7450 | 7100 | 0 | 39,0 | 51,0 | 0,07400 |
| 62307-2RS | 35 | 80 | 31,0 | 33000 | 18500 | 5500 | 0 | 44,1 | 70,8 | 0,68700 |
| SS-6307-2RS | 35 | 80 | 21,0 | 30000 | 17100 | 4800 | 0 | 44,0 | 71,0 | 0,45700 |

Kugellager

| Kurz-Zeichen | Haupt-Abmessungen [mm] | | | Trag-Zahlen [N] | | Grenz-Drehzahlen [min-1] | | Anschluss-Maße [mm] | | Gewicht [kg] |
|--------------|------------------------|-----|------|-----------------|-----------|--------------------------|-------|---------------------|--------|--------------|
| | d | D | B | dyn. Cr | stat. Cor | Fett | Öl | da min | Da max | |
| 6307 ** | 35 | 80 | 21,0 | 33500 | 18300 | 8500 | 10000 | 44,0 | 71,0 | 0,45000 |
| 63007-2RS | 35 | 62 | 20,0 | 14800 | 9800 | 6700 | 0 | 39,7 | 57,4 | 0,21000 |
| 16007-ZZ | 35 | 62 | 9,0 | 12200 | 8850 | 10000 | 0 | 37,0 | 60,0 | 0,11100 |
| 6907 | 35 | 55 | 10,0 | 11200 | 7450 | 12000 | 15000 | 39,0 | 51,0 | 0,07400 |
| SS-6907-2RS | 35 | 55 | 10,0 | 8960 | 5960 | 6200 | 0 | 39,0 | 51,0 | 0,07400 |
| SS-6207-2RS | 35 | 72 | 17,0 | 23000 | 13800 | 5000 | 0 | 42,0 | 65,0 | 0,28800 |
| 6807 | 35 | 47 | 7,0 | 4000 | 3250 | 13000 | 16000 | 37,0 | 45,0 | 0,02900 |
| 6207-ZZ ** | 35 | 72 | 17,0 | 25700 | 15400 | 9000 | 0 | 42,0 | 65,0 | 0,31500 |
| 6007 ** | 35 | 62 | 14,0 | 15900 | 10300 | 10000 | 13000 | 39,6 | 57,4 | 0,16400 |
| 6007-2RS ** | 35 | 62 | 14,0 | 15900 | 10300 | 7000 | 0 | 39,6 | 57,4 | 0,16400 |
| 6407 | 35 | 100 | 25,0 | 55500 | 29400 | 7000 | 8500 | 46,0 | 89,0 | 0,95100 |
| SS-6807-2RS | 35 | 47 | 7,0 | 3200 | 2600 | 6500 | 0 | 37,0 | 45,0 | 0,02900 |
| 62207-2RS | 35 | 72 | 23,0 | 25000 | 15000 | 6000 | 0 | 42,0 | 64,8 | 0,39300 |
| 6807-ZZ | 35 | 47 | 7,0 | 4000 | 3250 | 13000 | 0 | 37,0 | 45,0 | 0,02900 |
| 6307-ZZ ** | 35 | 80 | 21,0 | 33500 | 18300 | 8500 | 0 | 44,0 | 71,0 | 0,45000 |
| 6207-2RS ** | 35 | 72 | 17,0 | 25700 | 15400 | 6000 | 0 | 42,0 | 65,0 | 0,31500 |
| 6207 ** | 35 | 72 | 17,0 | 25700 | 15400 | 9000 | 11000 | 42,0 | 65,0 | 0,31500 |
| 16007 | 35 | 62 | 9,0 | 12200 | 8850 | 10000 | 13000 | 37,0 | 60,0 | 0,11100 |
| 6807-2RS | 35 | 47 | 7,0 | 4000 | 3250 | 7600 | 0 | 37,0 | 45,0 | 0,02900 |
| 16007-2RS | 35 | 62 | 9,0 | 12200 | 8850 | 0 | 0 | 37,0 | 60,0 | 0,11100 |
| 6007-ZZ ** | 35 | 62 | 14,0 | 15900 | 10300 | 10000 | 0 | 39,6 | 57,4 | 0,16400 |
| 6307-2RS ** | 35 | 80 | 21,0 | 33500 | 18300 | 5600 | 0 | 44,0 | 71,0 | 0,45000 |
| 6907-ZZ | 35 | 55 | 10,0 | 11200 | 7450 | 12000 | 0 | 39,0 | 51,0 | 0,07400 |
| 6808-2RS | 40 | 52 | 7,0 | 4500 | 4050 | 6700 | 0 | 42,0 | 50,0 | 0,03300 |
| 6308 ** | 40 | 90 | 23,0 | 40700 | 24000 | 7500 | 9000 | 49,0 | 81,0 | 0,63500 |
| 6008 ** | 40 | 68 | 15,0 | 16800 | 11600 | 9500 | 12000 | 44,6 | 63,4 | 0,21000 |
| 6008-2RS ** | 40 | 68 | 15,0 | 16800 | 11600 | 6000 | 0 | 44,6 | 63,4 | 0,21000 |
| 6808-ZZ | 40 | 52 | 7,0 | 4500 | 4050 | 12000 | 0 | 42,0 | 50,0 | 0,03300 |
| 16008 | 40 | 68 | 9,0 | 13300 | 9800 | 9500 | 12000 | 42,0 | 66,0 | 0,13000 |
| SS-6308-2RS | 40 | 90 | 23,0 | 36400 | 21600 | 4200 | 0 | 49,0 | 81,0 | 0,63000 |
| SS-6808-2RS | 40 | 52 | 7,0 | 3600 | 3240 | 5500 | 0 | 42,0 | 50,0 | 0,03300 |
| 16008-ZZ | 40 | 68 | 9,0 | 13300 | 9800 | 9500 | 0 | 42,0 | 66,0 | 0,13000 |
| 62308-2RS | 40 | 90 | 33,0 | 42000 | 24500 | 4800 | 0 | 49,0 | 81,0 | 0,90800 |
| SS-6908-2RS | 40 | 62 | 12,0 | 11680 | 8160 | 5200 | 0 | 44,0 | 58,0 | 0,11000 |
| 62208-2RS | 40 | 80 | 23,0 | 28500 | 17500 | 5500 | 0 | 47,0 | 73,0 | 0,48000 |
| 6208-ZZ ** | 40 | 80 | 18,0 | 32000 | 17800 | 8500 | 0 | 47,0 | 73,0 | 0,40200 |
| 6208 ** | 40 | 80 | 18,0 | 32000 | 17800 | 8500 | 10000 | 47,0 | 73,0 | 0,40200 |
| 6308-2RS ** | 40 | 90 | 23,0 | 40700 | 24000 | 5000 | 0 | 49,0 | 81,0 | 0,63500 |
| SS-6008-2RS | 40 | 68 | 15,0 | 15100 | 10300 | 4800 | 0 | 44,6 | 63,4 | 0,19000 |
| 6908-ZZ | 40 | 62 | 12,0 | 14600 | 10200 | 11000 | 0 | 44,0 | 58,0 | 0,11000 |
| 6308-ZZ ** | 40 | 90 | 23,0 | 40700 | 24000 | 7500 | 0 | 49,0 | 81,0 | 0,63500 |
| 6208-2RS ** | 40 | 80 | 18,0 | 32000 | 17800 | 5600 | 0 | 47,0 | 73,0 | 0,40200 |
| 63008-2RS | 40 | 68 | 21,0 | 15900 | 10900 | 5900 | 0 | 44,6 | 63,3 | 0,26000 |
| 6808 | 40 | 52 | 7,0 | 4500 | 4050 | 12000 | 14000 | 42,0 | 50,0 | 0,03300 |
| 6008-ZZ ** | 40 | 68 | 15,0 | 16800 | 11600 | 9500 | 0 | 44,6 | 63,4 | 0,21000 |

Kugellager

| Kurz-Zeichen | Haupt-Abmessungen [mm] | | | Trag-Zahlen [N] | | Grenz-Drehzahlen [min-1] | | Anschluss-Maße [mm] | | Gewicht [kg] |
|--------------|------------------------|-----|------|-----------------|-----------|--------------------------|-------|---------------------|--------|--------------|
| | d | D | B | dyn. Cr | stat. Cor | Fett | Öl | da min | Da max | |
| SS-6208-2RS | 40 | 80 | 18,0 | 26200 | 16000 | 4500 | 0 | 47,0 | 73,0 | 0,36600 |
| 6408 | 40 | 110 | 27,0 | 64000 | 35000 | 6700 | 8000 | 53,0 | 97,0 | 1,22700 |
| 6908-2RS | 40 | 62 | 12,0 | 14600 | 10200 | 6300 | 0 | 44,0 | 58,0 | 0,11000 |
| 16008-2RS | 40 | 68 | 9,0 | 13300 | 9800 | 0 | 0 | 42,0 | 66,0 | 0,13000 |
| 6908 | 40 | 62 | 12,0 | 14600 | 10200 | 11000 | 13000 | 44,0 | 58,0 | 0,11000 |
| 62209-2RS | 45 | 85 | 23,0 | 30000 | 20000 | 5100 | 0 | 52,1 | 77,8 | 0,52500 |
| 16009 | 45 | 75 | 10,0 | 15600 | 12300 | 9000 | 11000 | 48,2 | 71,8 | 0,17000 |
| 6909-ZZ | 45 | 68 | 12,0 | 15100 | 11200 | 9800 | 0 | 49,0 | 64,0 | 0,12800 |
| 63009-2RS | 45 | 75 | 23,0 | 19800 | 13900 | 5000 | 0 | 50,9 | 69,1 | 0,34000 |
| 6409 | 45 | 120 | 29,0 | 76100 | 44900 | 5600 | 6700 | 58,0 | 99,9 | 1,54000 |
| 6209-ZZ ** | 45 | 85 | 19,0 | 32700 | 20200 | 8000 | 0 | 52,0 | 78,0 | 0,41400 |
| 6009-ZZ ** | 45 | 75 | 16,0 | 21000 | 15000 | 9000 | 0 | 49,6 | 70,4 | 0,26100 |
| 6809-2RS | 45 | 58 | 7,0 | 6400 | 5650 | 5900 | 0 | 47,0 | 56,0 | 0,04000 |
| 6009 ** | 45 | 75 | 16,0 | 21000 | 15000 | 9000 | 11000 | 49,6 | 70,4 | 0,26100 |
| 6809 | 45 | 58 | 7,0 | 6400 | 5650 | 9500 | 12000 | 47,0 | 56,0 | 0,04000 |
| 6909-2RS | 45 | 68 | 12,0 | 15100 | 11200 | 5600 | 0 | 49,0 | 64,0 | 0,12800 |
| SS-6209-2RS | 45 | 85 | 19,0 | 29430 | 18100 | 4240 | 0 | 52,0 | 78,0 | 0,41400 |
| SS-6009-2RS | 45 | 75 | 16,0 | 20800 | 14600 | 4480 | 0 | 49,6 | 70,4 | 0,26100 |
| 6309-ZZ ** | 45 | 100 | 25,0 | 52700 | 31700 | 6700 | 0 | 54,0 | 91,0 | 0,83800 |
| 6209-2RS ** | 45 | 85 | 19,0 | 32700 | 20200 | 5300 | 0 | 52,0 | 78,0 | 0,41400 |
| 6309-2RS ** | 45 | 100 | 25,0 | 52700 | 31700 | 4300 | 0 | 54,0 | 91,0 | 0,83800 |
| 6209 ** | 45 | 85 | 19,0 | 32700 | 20200 | 8000 | 9500 | 52,0 | 78,0 | 0,41400 |
| 62309-2RS | 45 | 100 | 36,0 | 52500 | 31000 | 4200 | 0 | 54,2 | 90,8 | 0,88000 |
| 6009-2RS ** | 45 | 75 | 16,0 | 21000 | 15000 | 5600 | 0 | 49,6 | 70,4 | 0,26100 |
| 6309 ** | 45 | 100 | 25,0 | 52700 | 31700 | 6700 | 8000 | 54,0 | 91,0 | 0,83800 |
| 16009-ZZ | 45 | 75 | 10,0 | 15600 | 12300 | 9000 | 0 | 48,2 | 71,8 | 0,17000 |
| 6909 | 45 | 68 | 12,0 | 15100 | 11200 | 9800 | 12000 | 49,0 | 64,0 | 0,12800 |
| 16009-2RS | 45 | 75 | 10,0 | 15600 | 12300 | 0 | 0 | 48,2 | 71,8 | 0,17000 |
| 6809-ZZ | 45 | 58 | 7,0 | 6400 | 5650 | 9500 | 0 | 47,0 | 56,0 | 0,04000 |
| SS-6309-2RS | 45 | 85 | 23,0 | 47400 | 28500 | 4000 | 0 | 52,0 | 78,0 | 0,83800 |
| SS-6210-2RS | 50 | 90 | 20,0 | 31600 | 23200 | 3600 | 0 | 57,0 | 83,0 | 0,46000 |
| SS-6310-2RS | 50 | 110 | 27,0 | 55800 | 34100 | 3200 | 0 | 61,0 | 99,0 | 1,06200 |
| 62210-2RS | 50 | 90 | 23,0 | 36000 | 23500 | 4600 | 0 | 57,1 | 82,9 | 0,54400 |
| 6410 | 50 | 130 | 31,0 | 87100 | 52000 | 5000 | 6000 | 64,0 | 99,9 | 1,89000 |
| 6010-ZZ ** | 50 | 80 | 16,0 | 21800 | 16500 | 8500 | 0 | 54,6 | 75,4 | 0,26000 |
| 6310 ** | 50 | 110 | 27,0 | 62000 | 37900 | 6000 | 7000 | 61,0 | 99,0 | 1,06200 |
| 6310-ZZ ** | 50 | 110 | 27,0 | 62000 | 37900 | 6000 | 0 | 61,0 | 99,0 | 1,06200 |
| 6010-2RS ** | 50 | 80 | 16,0 | 21800 | 16500 | 5300 | 0 | 54,6 | 75,4 | 0,26000 |
| 6910 | 50 | 72 | 12,0 | 15600 | 12200 | 8900 | 11000 | 54,0 | 68,0 | 0,13200 |
| 6810 | 50 | 65 | 7,0 | 6600 | 6100 | 9600 | 11000 | 52,0 | 63,0 | 0,05200 |
| 16010-ZZ | 50 | 80 | 10,0 | 16300 | 13100 | 8500 | 0 | 53,2 | 76,8 | 0,18800 |
| 6310-2RS ** | 50 | 110 | 27,0 | 62000 | 37900 | 4000 | 0 | 61,0 | 99,0 | 1,06200 |
| 6810-2RS | 50 | 65 | 7,0 | 6600 | 6100 | 5300 | 0 | 52,0 | 63,0 | 0,05200 |
| 6910-ZZ | 50 | 72 | 12,0 | 15600 | 12200 | 8900 | 0 | 54,0 | 68,0 | 0,13200 |
| 6210-ZZ ** | 50 | 90 | 20,0 | 35100 | 23100 | 7000 | 0 | 57,0 | 83,0 | 0,46000 |

Kugellager

| Kurz-Zeichen | Haupt-Abmessungen [mm] | | | Trag-Zahlen [N] | | Grenz-Drehzahlen [min-1] | | Anschluss-Maße [mm] | | Gewicht [kg] |
|--------------|------------------------|-----|------|-----------------|-----------|--------------------------|-------|---------------------|--------|--------------|
| | d | D | B | dyn. Cr | stat. Cor | Fett | Öl | da min | Da max | |
| 16010 | 50 | 80 | 10,0 | 16300 | 13100 | 8500 | 10000 | 53,2 | 76,8 | 0,18800 |
| 6810-ZZ | 50 | 65 | 7,0 | 6600 | 6100 | 9600 | 0 | 52,0 | 63,0 | 0,05200 |
| SS-6010-2RS | 50 | 80 | 16,0 | 19600 | 14800 | 4240 | 0 | 54,6 | 75,4 | 0,26000 |
| 6910-2RS | 50 | 72 | 12,0 | 15600 | 12200 | 5100 | 0 | 54,0 | 68,0 | 0,13200 |
| 16010-2RS | 50 | 80 | 10,0 | 16300 | 13100 | 0 | 0 | 53,2 | 76,8 | 0,18800 |
| 6210-2RS ** | 50 | 90 | 20,0 | 35100 | 23100 | 4500 | 0 | 57,0 | 83,0 | 0,46000 |
| 6210 ** | 50 | 90 | 20,0 | 35100 | 23100 | 7000 | 8500 | 57,0 | 83,0 | 0,46000 |
| 6010 ** | 50 | 80 | 16,0 | 21800 | 16500 | 8500 | 10000 | 54,6 | 75,4 | 0,26000 |
| 62310-2RS | 50 | 110 | 40,0 | 61500 | 37400 | 3800 | 0 | 61,2 | 98,9 | 1,60000 |
| 6211-ZZ ** | 55 | 100 | 21,0 | 43600 | 29300 | 6300 | 0 | 64,0 | 91,0 | 0,61100 |
| 62211-2RS | 55 | 100 | 25,0 | 43000 | 28500 | 4100 | 0 | 63,9 | 91,0 | 0,71000 |
| 16011 | 55 | 90 | 11,0 | 19300 | 16300 | 7500 | 9000 | 58,2 | 86,8 | 0,26000 |
| 6011 ** | 55 | 90 | 18,0 | 28100 | 21200 | 7500 | 9000 | 61,0 | 84,0 | 0,39000 |
| 6211 ** | 55 | 100 | 21,0 | 43600 | 29300 | 6300 | 7500 | 64,0 | 91,0 | 0,61100 |
| 6211-2RS ** | 55 | 100 | 21,0 | 43600 | 29300 | 4000 | 0 | 64,0 | 91,0 | 0,61100 |
| 6011-ZZ ** | 55 | 90 | 18,0 | 28100 | 21200 | 7500 | 0 | 61,0 | 84,0 | 0,39000 |
| 6011-2RS ** | 55 | 90 | 18,0 | 28100 | 21200 | 4500 | 0 | 61,0 | 84,0 | 0,39000 |
| 6311 ** | 55 | 120 | 29,0 | 71500 | 44600 | 5300 | 6300 | 66,0 | 99,9 | 1,38000 |
| 6911-2RS | 55 | 80 | 13,0 | 16000 | 13300 | 4600 | 0 | 60,0 | 75,0 | 0,18000 |
| 6311-2RS ** | 55 | 120 | 29,0 | 71500 | 44600 | 3600 | 0 | 66,0 | 99,9 | 1,38000 |
| 6911-ZZ | 55 | 80 | 13,0 | 16000 | 13300 | 8200 | 0 | 60,0 | 75,0 | 0,18000 |
| 6811-2RS | 55 | 72 | 9,0 | 8800 | 8100 | 4800 | 0 | 57,0 | 70,0 | 0,08300 |
| 62311-2RS | 55 | 120 | 43,0 | 71000 | 44000 | 3600 | 0 | 66,0 | 99,9 | 1,98000 |
| 6811-ZZ | 55 | 72 | 9,0 | 8800 | 8100 | 8700 | 0 | 57,0 | 70,0 | 0,08300 |
| 6411 | 55 | 140 | 33,0 | 100000 | 62000 | 4800 | 5600 | 69,0 | 99,9 | 2,30000 |
| 6911 | 55 | 80 | 13,0 | 16000 | 13300 | 8200 | 9600 | 60,0 | 75,0 | 0,18000 |
| 6811 | 55 | 72 | 9,0 | 8800 | 8100 | 8700 | 10000 | 57,0 | 70,0 | 0,08300 |
| 6311-ZZ ** | 55 | 120 | 29,0 | 71500 | 44600 | 5300 | 0 | 66,0 | 99,9 | 1,38000 |
| SS-6211-2RS | 55 | 100 | 21,0 | 39200 | 26400 | 3200 | 0 | 64,0 | 91,0 | 0,61100 |
| SS-6011-2RS | 55 | 90 | 18,0 | 25300 | 19100 | 3600 | 0 | 61,0 | 84,0 | 0,39000 |
| 6912 | 60 | 85 | 13,0 | 16400 | 14300 | 7600 | 8900 | 65,0 | 80,0 | 0,19300 |
| 6912-2RS | 60 | 85 | 13,0 | 16400 | 14300 | 4300 | 0 | 65,0 | 80,0 | 0,19300 |
| SS-6012-2RS | 60 | 95 | 18,0 | 26600 | 20900 | 3440 | 0 | 66,0 | 89,0 | 0,42000 |
| 6812-2RS | 60 | 78 | 10,0 | 11500 | 10600 | 4400 | 0 | 62,0 | 76,0 | 0,10600 |
| 6312 ** | 60 | 130 | 31,0 | 81500 | 51900 | 5000 | 6000 | 72,0 | 99,9 | 1,72000 |
| 62312-2RS | 60 | 130 | 46,0 | 81000 | 51500 | 3100 | 0 | 72,0 | 99,9 | 2,52000 |
| 6212-ZZ ** | 60 | 110 | 22,0 | 52400 | 36000 | 6000 | 0 | 69,0 | 99,9 | 0,78000 |
| 62212-2RS | 60 | 110 | 28,0 | 52000 | 35500 | 3800 | 0 | 69,1 | 99,9 | 0,98000 |
| 6412 | 60 | 150 | 35,0 | 110000 | 70800 | 1800 | 5600 | 74,0 | 99,9 | 2,76000 |
| 6212 ** | 60 | 110 | 22,0 | 52400 | 36000 | 6000 | 7000 | 69,0 | 99,9 | 0,78000 |
| 6812-ZZ | 60 | 78 | 10,0 | 11500 | 10600 | 8000 | 0 | 62,0 | 76,0 | 0,10600 |
| 6312-2RS ** | 60 | 130 | 31,0 | 81500 | 51900 | 3400 | 0 | 72,0 | 99,9 | 1,72000 |
| SS-6312-2RS | 60 | 130 | 31,0 | 73400 | 46700 | 2900 | 0 | 72,0 | 99,9 | 1,72000 |
| 6812 | 60 | 78 | 10,0 | 11500 | 10600 | 8000 | 9400 | 62,0 | 76,0 | 0,10600 |
| 6212-2RS ** | 60 | 110 | 22,0 | 52400 | 36000 | 4000 | 0 | 69,0 | 99,9 | 0,78000 |

Kugellager

| Kurz-Zeichen | Haupt-Abmessungen [mm] | | | Trag-Zahlen [N] | | Grenz-Drehzahlen [min-1] | | Anschluss-Maße [mm] | | Gewicht [kg] |
|--------------|------------------------|-----|------|-----------------|-----------|--------------------------|------|---------------------|--------|--------------|
| | d | D | B | dyn. Cr | stat. Cor | Fett | Öl | da min | Da max | |
| 16012 | 60 | 95 | 11,0 | 19900 | 17600 | 7000 | 8500 | 63,2 | 91,8 | 0,28000 |
| 6012-2RS ** | 60 | 95 | 18,0 | 29400 | 23200 | 4300 | 0 | 66,0 | 89,0 | 0,42000 |
| 6012 ** | 60 | 95 | 18,0 | 29400 | 23200 | 7800 | 8500 | 66,0 | 89,0 | 0,42000 |
| SS-6212-2RS | 60 | 110 | 22,0 | 47500 | 32500 | 3000 | 0 | 69,0 | 99,9 | 0,78000 |
| 6012-ZZ ** | 60 | 95 | 18,0 | 29400 | 23200 | 7800 | 0 | 66,0 | 89,0 | 0,42000 |
| 6312-ZZ ** | 60 | 130 | 31,0 | 81500 | 51900 | 5000 | 0 | 72,0 | 99,9 | 1,72000 |
| 6912-ZZ | 60 | 85 | 13,0 | 16400 | 14300 | 7600 | 0 | 65,0 | 80,0 | 0,19300 |
| 6013-2RS ** | 65 | 100 | 18,0 | 30500 | 25200 | 4000 | 0 | 71,0 | 94,0 | 0,44000 |
| 6013-ZZ ** | 65 | 100 | 18,0 | 30500 | 25200 | 6300 | 0 | 71,0 | 94,0 | 0,44000 |
| 6813-2RS | 65 | 85 | 10,0 | 11600 | 11000 | 4100 | 0 | 69,0 | 81,0 | 0,12800 |
| 62213-2RS | 65 | 120 | 31,0 | 55000 | 40000 | 3000 | 0 | 74,0 | 99,9 | 1,26000 |
| 6913 | 65 | 90 | 13,0 | 17400 | 16100 | 7000 | 8200 | 70,0 | 85,0 | 0,20600 |
| 6813 | 65 | 85 | 10,0 | 11600 | 11000 | 7400 | 8700 | 69,0 | 81,0 | 0,12800 |
| 6413 | 65 | 160 | 37,0 | 118000 | 79000 | 4000 | 4800 | 79,0 | 99,9 | 3,30000 |
| 6913-ZZ | 65 | 90 | 13,0 | 17400 | 16100 | 7000 | 0 | 70,0 | 85,0 | 0,20600 |
| 6313-2RS ** | 65 | 140 | 33,0 | 93000 | 59700 | 3000 | 0 | 77,0 | 99,9 | 2,10000 |
| 6013 ** | 65 | 100 | 18,0 | 30500 | 25200 | 6300 | 7500 | 71,0 | 94,0 | 0,44000 |
| 6213-ZZ ** | 65 | 120 | 23,0 | 57200 | 40000 | 5300 | 0 | 74,0 | 99,9 | 0,99500 |
| 6313-ZZ ** | 65 | 140 | 33,0 | 93000 | 59700 | 4800 | 0 | 77,0 | 99,9 | 2,10000 |
| 62313-2RS | 65 | 140 | 48,0 | 91700 | 59000 | 2800 | 0 | 77,0 | 99,9 | 3,00000 |
| 16013 | 65 | 100 | 11,0 | 22900 | 19600 | 6300 | 7500 | 68,2 | 96,8 | 0,30000 |
| 6813-ZZ | 65 | 85 | 10,0 | 11600 | 11000 | 7400 | 0 | 69,0 | 81,0 | 0,12800 |
| 6913-2RS | 65 | 90 | 13,0 | 17400 | 16100 | 4000 | 0 | 70,0 | 85,0 | 0,20600 |
| 6213-2RS ** | 65 | 120 | 23,0 | 57200 | 40000 | 3600 | 0 | 74,0 | 99,9 | 0,99500 |
| 6213 ** | 65 | 120 | 23,0 | 57200 | 40000 | 5300 | 6300 | 74,0 | 99,9 | 0,99500 |
| 6313 ** | 65 | 140 | 33,0 | 93000 | 59700 | 4800 | 5600 | 77,0 | 99,9 | 2,10000 |
| 6914-ZZ | 70 | 100 | 16,0 | 23700 | 21200 | 6500 | 0 | 75,0 | 95,0 | 0,33400 |
| 6214-ZZ ** | 70 | 125 | 24,0 | 62200 | 44100 | 5000 | 0 | 79,0 | 99,9 | 1,07000 |
| 6914-2RS | 70 | 100 | 16,0 | 23700 | 21200 | 3700 | 0 | 75,0 | 95,0 | 0,33400 |
| 6014-2RS ** | 70 | 110 | 20,0 | 38100 | 30900 | 3600 | 0 | 76,0 | 99,9 | 0,60000 |
| 6414 | 70 | 180 | 42,0 | 143000 | 104000 | 3800 | 4500 | 86,0 | 99,9 | 4,85000 |
| SS-6014-2RS | 70 | 110 | 20,0 | 34300 | 28000 | 3050 | 0 | 76,0 | 99,9 | 0,60000 |
| 6914 | 70 | 100 | 16,0 | 23700 | 21200 | 6500 | 7700 | 75,0 | 95,0 | 0,33400 |
| 6014-ZZ ** | 70 | 110 | 20,0 | 38100 | 30900 | 6000 | 0 | 76,0 | 99,9 | 0,60000 |
| 6814-ZZ | 70 | 90 | 10,0 | 12100 | 11900 | 6900 | 0 | 74,0 | 86,0 | 0,13700 |
| 62214-2RS | 70 | 125 | 31,0 | 59000 | 44000 | 3000 | 0 | 79,0 | 99,9 | 1,35000 |
| 6014 ** | 70 | 110 | 20,0 | 38100 | 30900 | 6000 | 7000 | 76,0 | 99,9 | 0,60000 |
| 6314 ** | 70 | 150 | 35,0 | 104000 | 68100 | 4500 | 5300 | 82,0 | 99,9 | 2,50000 |
| 6214-2RS ** | 70 | 125 | 24,0 | 62200 | 44100 | 3400 | 0 | 79,0 | 99,9 | 1,07000 |
| 62314-2RS | 70 | 150 | 51,0 | 102000 | 66500 | 2600 | 0 | 82,0 | 99,9 | 3,56000 |
| SS-6314-2RS | 70 | 150 | 35,0 | 94000 | 61300 | 2400 | 0 | 82,0 | 99,9 | 2,50000 |
| SS-6214-2RS | 70 | 125 | 24,0 | 56000 | 39700 | 2850 | 0 | 79,0 | 99,9 | 1,07000 |
| 6814-2RS | 70 | 90 | 10,0 | 12100 | 11900 | 3800 | 0 | 74,0 | 86,0 | 0,13700 |
| 6314-2RS ** | 70 | 150 | 35,0 | 104000 | 68100 | 2800 | 0 | 82,0 | 99,9 | 2,50000 |
| 6814 | 70 | 90 | 10,0 | 12100 | 11900 | 6900 | 8100 | 74,0 | 86,0 | 0,13700 |

Kugellager

| Kurz-Zeichen | Haupt-Abmessungen [mm] | | | Trag-Zahlen [N] | | Grenz-Drehzahlen [min-1] | | Anschluss-Maße [mm] | | Gewicht [kg] |
|--------------|------------------------|-----|------|-----------------|-----------|--------------------------|------|---------------------|--------|--------------|
| | d | D | B | dyn. Cr | stat. Cor | Fett | Öl | da min | Da max | |
| 6214 ** | 70 | 125 | 24,0 | 62200 | 44100 | 5000 | 6000 | 79,0 | 99,9 | 1,07000 |
| 16014 | 70 | 110 | 13,0 | 28100 | 25000 | 6000 | 7000 | 73,2 | 99,9 | 0,43300 |
| 6314-ZZ ** | 70 | 150 | 35,0 | 104000 | 68100 | 4500 | 0 | 82,0 | 99,9 | 2,50000 |
| 6815 | 75 | 95 | 10,0 | 12500 | 12900 | 6400 | 7600 | 79,0 | 91,0 | 0,14500 |
| 6815-2RS | 75 | 95 | 10,0 | 12500 | 12900 | 3600 | 0 | 79,0 | 91,0 | 0,14500 |
| 6915 | 75 | 105 | 16,0 | 24400 | 22600 | 6100 | 7200 | 80,0 | 99,9 | 0,35300 |
| 16015 | 75 | 115 | 13,0 | 28600 | 26800 | 5600 | 6700 | 78,2 | 99,9 | 0,46000 |
| SS-6015-2RS | 75 | 115 | 20,0 | 36000 | 30200 | 2750 | 0 | 81,0 | 99,9 | 0,64000 |
| 6915-2RS | 75 | 105 | 16,0 | 24400 | 22600 | 3500 | 0 | 80,0 | 99,9 | 0,35300 |
| 6815-ZZ | 75 | 95 | 10,0 | 12500 | 12900 | 6400 | 0 | 79,0 | 91,0 | 0,14500 |
| 6215 ** | 75 | 130 | 25,0 | 67400 | 49300 | 4800 | 5600 | 84,0 | 99,9 | 1,18000 |
| 6415 | 75 | 190 | 45,0 | 153000 | 115000 | 3600 | 4300 | 91,0 | 99,9 | 6,50000 |
| 6315-2RS ** | 75 | 160 | 37,0 | 114000 | 77000 | 2800 | 0 | 87,0 | 99,9 | 3,03000 |
| 6915-ZZ | 75 | 105 | 16,0 | 24400 | 22600 | 6100 | 0 | 80,0 | 99,9 | 0,35300 |
| 6215-ZZ ** | 75 | 130 | 25,0 | 67400 | 49300 | 4800 | 0 | 84,0 | 99,9 | 1,18000 |
| 6015-ZZ ** | 75 | 115 | 20,0 | 39700 | 33500 | 5600 | 0 | 81,0 | 99,9 | 0,64000 |
| 6215-2RS ** | 75 | 130 | 25,0 | 67400 | 49300 | 3200 | 0 | 84,0 | 99,9 | 1,18000 |
| 6015-2RS ** | 75 | 115 | 20,0 | 39700 | 33500 | 3400 | 0 | 81,0 | 99,9 | 0,64000 |
| 6315-ZZ ** | 75 | 160 | 37,0 | 114000 | 77000 | 4300 | 0 | 87,0 | 99,9 | 3,03000 |
| 6315 ** | 75 | 160 | 37,0 | 114000 | 77000 | 4300 | 5000 | 87,0 | 99,9 | 3,03000 |
| 6015 ** | 75 | 115 | 20,0 | 39700 | 33500 | 5600 | 6700 | 81,0 | 99,9 | 0,64000 |
| 6916 | 80 | 110 | 16,0 | 24900 | 24000 | 5700 | 6700 | 85,0 | 99,9 | 0,37300 |
| 6316-ZZ ** | 80 | 170 | 39,0 | 122000 | 86500 | 3800 | 0 | 92,0 | 99,9 | 3,60000 |
| 6216-ZZ ** | 80 | 140 | 26,0 | 72700 | 53000 | 4500 | 0 | 91,0 | 99,9 | 1,40000 |
| SS-6016-2RS | 80 | 125 | 22,0 | 43000 | 36000 | 2600 | 0 | 86,0 | 99,9 | 0,85000 |
| 6316-2RS ** | 80 | 170 | 39,0 | 122000 | 86500 | 2700 | 0 | 92,0 | 99,9 | 3,60000 |
| 16016 | 80 | 125 | 14,0 | 31900 | 29700 | 5300 | 6300 | 83,2 | 99,9 | 0,60000 |
| 6316 ** | 80 | 170 | 39,0 | 122000 | 86500 | 3800 | 4500 | 92,0 | 99,9 | 3,60000 |
| 6016 ** | 80 | 125 | 22,0 | 47500 | 39800 | 5300 | 6300 | 86,0 | 99,9 | 0,85000 |
| 6816-2RS | 80 | 100 | 10,0 | 12700 | 13300 | 3400 | 0 | 84,0 | 96,0 | 0,15400 |
| 6916-ZZ | 80 | 110 | 16,0 | 24900 | 24000 | 5700 | 0 | 85,0 | 99,9 | 0,37300 |
| 6816 | 80 | 100 | 10,0 | 12700 | 13300 | 6000 | 7100 | 84,0 | 96,0 | 0,15400 |
| 6816-ZZ | 80 | 100 | 10,0 | 12700 | 13300 | 6000 | 0 | 84,0 | 96,0 | 0,15400 |
| 6216 ** | 80 | 140 | 26,0 | 72700 | 53000 | 4500 | 5300 | 91,0 | 99,9 | 1,40000 |
| 6416 | 80 | 200 | 48,0 | 164000 | 125000 | 3400 | 4000 | 96,0 | 99,9 | 7,50000 |
| 6016-2RS ** | 80 | 125 | 22,0 | 47500 | 39800 | 3100 | 0 | 86,0 | 99,9 | 0,85000 |
| 6916-2RS | 80 | 110 | 16,0 | 24900 | 24000 | 3200 | 0 | 85,0 | 99,9 | 0,37300 |
| 6016-ZZ ** | 80 | 125 | 22,0 | 47500 | 39800 | 5300 | 0 | 86,0 | 99,9 | 0,85000 |
| 6216-2RS ** | 80 | 140 | 26,0 | 72700 | 53000 | 3000 | 0 | 91,0 | 99,9 | 1,40000 |
| 6217-ZZ ** | 85 | 150 | 28,0 | 83200 | 61900 | 4300 | 0 | 96,0 | 99,9 | 1,80000 |
| 6917-2RS | 85 | 120 | 18,0 | 32000 | 29600 | 3000 | 0 | 91,5 | 99,9 | 0,53600 |
| 6317-2RS | 85 | 180 | 41,0 | 133000 | 96600 | 2600 | 0 | 99,0 | 99,9 | 4,20000 |
| 6217-2RS ** | 85 | 150 | 28,0 | 83200 | 61900 | 2800 | 0 | 96,0 | 99,9 | 1,80000 |
| 6317 | 85 | 180 | 41,0 | 133000 | 96600 | 3600 | 4300 | 99,0 | 99,9 | 4,20000 |
| 16017 | 85 | 130 | 14,0 | 33800 | 33500 | 5000 | 6000 | 88,2 | 99,9 | 0,63000 |

Kugellager

| Kurz-Zeichen | Haupt-Abmessungen [mm] | | | Trag-Zahlen [N] | | Grenz-Drehzahlen [min-1] | | Anschluss-Maße [mm] | | Gewicht [kg] |
|--------------|------------------------|-----|------|-----------------|-----------|--------------------------|------|---------------------|--------|--------------|
| | d | D | B | dyn. Cr | stat. Cor | Fett | Öl | da min | Da max | |
| 6017 ** | 85 | 130 | 22,0 | 49400 | 43100 | 5000 | 6000 | 91,0 | 99,9 | 0,89000 |
| 6817-2RS | 85 | 110 | 13,0 | 18700 | 19000 | 3100 | 0 | 90,0 | 99,9 | 0,27000 |
| 6317-ZZ | 85 | 180 | 41,0 | 133000 | 96600 | 3600 | 0 | 99,0 | 99,9 | 4,20000 |
| 6817 | 85 | 110 | 13,0 | 18700 | 19000 | 5700 | 6700 | 90,0 | 99,9 | 0,27000 |
| 6017-2RS ** | 85 | 130 | 22,0 | 49400 | 43100 | 5000 | 0 | 91,0 | 99,9 | 0,89000 |
| 6017-ZZ ** | 85 | 130 | 22,0 | 49400 | 43100 | 5000 | 0 | 91,0 | 99,9 | 0,89000 |
| 6417 | 85 | 210 | 52,0 | 174000 | 136000 | 3200 | 3800 | 99,9 | 99,9 | 9,00000 |
| 6917-ZZ | 85 | 120 | 18,0 | 32000 | 29600 | 5400 | 0 | 91,5 | 99,9 | 0,53600 |
| 6817-ZZ | 85 | 110 | 13,0 | 18700 | 19000 | 5700 | 0 | 90,0 | 99,9 | 0,27000 |
| 6917 | 85 | 120 | 18,0 | 32000 | 29600 | 5400 | 6300 | 91,5 | 99,9 | 0,53600 |
| 6217 ** | 85 | 150 | 28,0 | 83200 | 61900 | 4300 | 5000 | 96,0 | 99,9 | 1,80000 |
| 16018 | 90 | 140 | 16,0 | 41600 | 40400 | 4800 | 5600 | 94,6 | 99,9 | 0,85000 |
| 6218-2RS | 90 | 160 | 30,0 | 95600 | 71500 | 2600 | 0 | 99,9 | 99,9 | 2,16000 |
| 6218 | 90 | 160 | 30,0 | 95600 | 71500 | 3800 | 4500 | 99,9 | 99,9 | 2,16000 |
| 6218-ZZ | 90 | 160 | 30,0 | 95600 | 71500 | 3800 | 0 | 99,9 | 99,9 | 2,16000 |
| 6018-2RS ** | 90 | 140 | 24,0 | 58500 | 49700 | 2800 | 0 | 97,0 | 99,9 | 1,16000 |
| 6818-ZZ | 90 | 115 | 13,0 | 19000 | 19700 | 5400 | 0 | 95,0 | 99,9 | 0,28500 |
| 6418 | 90 | 225 | 54,0 | 190000 | 160000 | 3000 | 3600 | 99,9 | 99,9 | 11,50000 |
| 6918-2RS | 90 | 125 | 18,0 | 33000 | 31500 | 2900 | 0 | 96,5 | 99,9 | 0,55400 |
| 6318-2RS | 90 | 190 | 43,0 | 143000 | 107000 | 2400 | 0 | 99,9 | 99,9 | 4,90000 |
| 6018 ** | 90 | 140 | 24,0 | 58500 | 49700 | 4800 | 5600 | 97,0 | 99,9 | 1,16000 |
| 6318 | 90 | 190 | 43,0 | 143000 | 107000 | 3400 | 4000 | 99,9 | 99,9 | 4,90000 |
| 6918 | 90 | 125 | 18,0 | 33000 | 31500 | 5100 | 6000 | 96,5 | 99,9 | 0,55400 |
| 6918-ZZ | 90 | 125 | 18,0 | 33000 | 31500 | 5100 | 0 | 96,5 | 99,9 | 0,55400 |
| 6018-ZZ ** | 90 | 140 | 24,0 | 58500 | 49700 | 4800 | 0 | 97,0 | 99,9 | 1,16000 |
| 6818 | 90 | 115 | 13,0 | 19000 | 19700 | 5400 | 6300 | 95,0 | 99,9 | 0,28500 |
| 6818-2RS | 90 | 115 | 13,0 | 19000 | 19700 | 3000 | 0 | 95,0 | 99,9 | 0,28500 |
| 6318-ZZ | 90 | 190 | 43,0 | 143000 | 107000 | 3400 | 0 | 99,9 | 99,9 | 4,90000 |
| 6919 | 95 | 130 | 18,0 | 33500 | 33500 | 4800 | 5700 | 99,9 | 99,9 | 0,57900 |
| 6219-ZZ | 95 | 170 | 32,0 | 109000 | 81900 | 3600 | 0 | 99,9 | 99,9 | 2,60000 |
| 6919-2RS | 95 | 130 | 18,0 | 33500 | 33500 | 2800 | 0 | 99,9 | 99,9 | 0,57900 |
| 6219-2RS | 95 | 170 | 32,0 | 109000 | 81900 | 2500 | 0 | 99,9 | 99,9 | 2,60000 |
| 6219 | 95 | 170 | 32,0 | 109000 | 81900 | 3600 | 4300 | 99,9 | 99,9 | 2,60000 |
| 6019-ZZ | 95 | 145 | 24,0 | 60500 | 53600 | 4300 | 0 | 99,9 | 99,9 | 1,20000 |
| 6019-2RS | 95 | 145 | 24,0 | 60500 | 53600 | 2600 | 0 | 99,9 | 99,9 | 1,20000 |
| 16019 | 95 | 145 | 16,0 | 42300 | 41500 | 4300 | 5000 | 99,6 | 99,9 | 0,89000 |
| 6019 | 95 | 145 | 24,0 | 60500 | 53600 | 4300 | 5000 | 99,9 | 99,9 | 1,20000 |
| 6819 | 95 | 120 | 13,0 | 19300 | 20500 | 5000 | 5900 | 99,9 | 99,9 | 0,30000 |
| 6819-ZZ | 95 | 120 | 13,0 | 19300 | 20500 | 5000 | 0 | 99,9 | 99,9 | 0,30000 |
| 6919-ZZ | 95 | 130 | 18,0 | 33500 | 33500 | 4800 | 0 | 99,9 | 99,9 | 0,57900 |
| 6319-ZZ | 95 | 200 | 45,0 | 153000 | 118000 | 3200 | 0 | 99,9 | 99,9 | 5,60000 |
| 6319-2RS | 95 | 200 | 45,0 | 153000 | 118000 | 2300 | 0 | 99,9 | 99,9 | 5,60000 |
| 6319 | 95 | 200 | 45,0 | 153000 | 118000 | 3200 | 3800 | 99,9 | 99,9 | 5,60000 |
| 6819-2RS | 95 | 120 | 13,0 | 19300 | 20500 | 2800 | 0 | 99,9 | 99,9 | 0,30000 |
| 6020-2RS | 100 | 150 | 24,0 | 60500 | 54000 | 2600 | 0 | 99,9 | 99,9 | 1,25000 |

Kugellager

| Kurz-Zeichen | Haupt-Abmessungen [mm] | | | Trag-Zahlen [N] | | Grenz-Drehzahlen [min-1] | | Anschluss-Maße [mm] | | Gewicht [kg] |
|--------------|------------------------|-----|------|-----------------|-----------|--------------------------|------|---------------------|--------|--------------|
| | d | D | B | dyn. Cr | stat. Cor | Fett | Öl | da min | Da max | |
| 6920-2RS | 100 | 140 | 20,0 | 41000 | 39500 | 0 | 0 | 99,9 | 99,9 | 0,78500 |
| 6220 | 100 | 180 | 34,0 | 124000 | 93000 | 3400 | 4000 | 99,9 | 99,9 | 3,50000 |
| 6220-ZZ | 100 | 180 | 34,0 | 124000 | 93000 | 3400 | 0 | 99,9 | 99,9 | 3,50000 |
| 6020 | 100 | 150 | 24,0 | 60500 | 54000 | 4300 | 5000 | 99,9 | 99,9 | 1,25000 |
| 6220-2RS | 100 | 180 | 34,0 | 124000 | 93000 | 2300 | 0 | 99,9 | 99,9 | 3,50000 |
| 16020 | 100 | 150 | 16,0 | 45000 | 44000 | 4300 | 5000 | 99,9 | 99,9 | 0,91000 |
| 6020-ZZ | 100 | 150 | 24,0 | 60500 | 54000 | 4300 | 0 | 99,9 | 99,9 | 1,25000 |
| 6320-ZZ | 100 | 215 | 47,0 | 173000 | 140000 | 3000 | 0 | 99,9 | 99,9 | 7,00000 |
| 6320 | 100 | 215 | 47,0 | 173000 | 140000 | 3000 | 3600 | 99,9 | 99,9 | 7,00000 |
| 6820 | 100 | 125 | 13,0 | 19600 | 21200 | 4800 | 5600 | 99,9 | 99,9 | 0,31300 |
| 6820-2RS | 100 | 125 | 13,0 | 19600 | 21200 | 2700 | 0 | 99,9 | 99,9 | 0,31300 |
| 6920-ZZ | 100 | 140 | 20,0 | 41000 | 39500 | 4500 | 0 | 99,9 | 99,9 | 0,78500 |
| 6820-ZZ | 100 | 125 | 13,0 | 19600 | 21200 | 4800 | 0 | 99,9 | 99,9 | 0,31300 |
| 6320-2RS | 100 | 215 | 47,0 | 173000 | 140000 | 2200 | 0 | 99,9 | 99,9 | 7,00000 |
| 6920 | 100 | 140 | 20,0 | 41000 | 39500 | 4500 | 5300 | 99,9 | 99,9 | 0,78500 |
| 6821 | 105 | 130 | 13,0 | 19800 | 22000 | 4600 | 5400 | 99,9 | 99,9 | 0,33000 |
| 6821-2RS | 105 | 130 | 13,0 | 19800 | 22000 | 0 | 0 | 99,9 | 99,9 | 0,33000 |
| 6021 | 105 | 160 | 26,0 | 72800 | 65800 | 4000 | 4800 | 99,9 | 99,9 | 1,60000 |
| 6321-ZZ | 105 | 225 | 49,0 | 184000 | 153000 | 2800 | 0 | 99,9 | 99,9 | 8,00000 |
| 6821-ZZ | 105 | 130 | 13,0 | 19800 | 22000 | 4600 | 0 | 99,9 | 99,9 | 0,33000 |
| 6221-2RS | 105 | 190 | 36,0 | 133000 | 104000 | 0 | 0 | 99,9 | 99,9 | 3,70000 |
| 6021-ZZ | 105 | 160 | 26,0 | 72800 | 65800 | 4000 | 0 | 99,9 | 99,9 | 1,60000 |
| 6221 | 105 | 190 | 36,0 | 133000 | 104000 | 3200 | 3800 | 99,9 | 99,9 | 3,70000 |
| 6321 | 105 | 225 | 49,0 | 184000 | 153000 | 2800 | 3400 | 99,9 | 99,9 | 8,00000 |
| 6921 | 105 | 145 | 20,0 | 42500 | 42000 | 4300 | 5100 | 99,9 | 99,9 | 0,81600 |
| 6021-2RS | 105 | 160 | 26,0 | 72800 | 65800 | 0 | 0 | 99,9 | 99,9 | 1,60000 |
| 6921-2RS | 105 | 145 | 20,0 | 42500 | 42000 | 2500 | 0 | 99,9 | 99,9 | 0,81600 |
| 16021 | 105 | 160 | 18,0 | 53000 | 51000 | 4000 | 4800 | 99,9 | 99,9 | 1,20000 |
| 6921-ZZ | 105 | 145 | 20,0 | 42500 | 42000 | 4300 | 0 | 99,9 | 99,9 | 0,81600 |
| 6221-ZZ | 105 | 190 | 36,0 | 133000 | 104000 | 3200 | 0 | 99,9 | 99,9 | 3,70000 |
| 6222-ZZ | 110 | 200 | 38,0 | 143000 | 118000 | 3000 | 0 | 99,9 | 99,9 | 4,35000 |
| 6322-ZZ | 110 | 240 | 50,0 | 203000 | 178000 | 2600 | 0 | 99,9 | 99,9 | 9,58000 |
| 6322 | 110 | 240 | 50,0 | 203000 | 178000 | 2600 | 3200 | 99,9 | 99,9 | 9,58000 |
| 16022 | 110 | 170 | 19,0 | 57200 | 56000 | 3800 | 4500 | 99,9 | 99,9 | 1,46000 |
| 6022 | 110 | 170 | 28,0 | 82000 | 73000 | 3800 | 4500 | 99,9 | 99,9 | 1,95000 |
| 6822-2RS | 110 | 140 | 16,0 | 28100 | 29000 | 0 | 0 | 99,9 | 99,9 | 0,51500 |
| 6922-ZZ | 110 | 150 | 20,0 | 43500 | 44500 | 4100 | 0 | 99,9 | 99,9 | 0,84900 |
| 6222-2RS | 110 | 200 | 38,0 | 143000 | 118000 | 0 | 0 | 99,9 | 99,9 | 4,35000 |
| 6822 | 110 | 140 | 16,0 | 28100 | 29000 | 4300 | 5100 | 99,9 | 99,9 | 0,51500 |
| 6922 | 110 | 150 | 20,0 | 43500 | 44500 | 4100 | 4800 | 99,9 | 99,9 | 0,84900 |
| 6022-ZZ | 110 | 170 | 28,0 | 82000 | 73000 | 3800 | 0 | 99,9 | 99,9 | 1,95000 |
| 6822-ZZ | 110 | 140 | 16,0 | 28100 | 29000 | 4300 | 0 | 99,9 | 99,9 | 0,51500 |
| 6922-2RS | 110 | 150 | 20,0 | 43500 | 44500 | 2400 | 0 | 99,9 | 99,9 | 0,84900 |
| 6222 | 110 | 200 | 38,0 | 143000 | 118000 | 3000 | 3600 | 99,9 | 99,9 | 4,35000 |
| 6322-2RS | 110 | 240 | 50,0 | 203000 | 178000 | 0 | 0 | 99,9 | 99,9 | 9,58000 |

Kugellager

| Kurz-Zeichen | Haupt-Abmessungen [mm] | | | Trag-Zahlen [N] | | Grenz-Drehzahlen [min-1] | | Anschluss-Maße [mm] | | Gewicht [kg] |
|--------------|------------------------|-----|------|-----------------|-----------|--------------------------|------|---------------------|--------|--------------|
| | d | D | B | dyn. Cr | stat. Cor | Fett | Öl | da min | Da max | |
| 6022-2RS | 110 | 170 | 28,0 | 82000 | 73000 | 0 | 0 | 99,9 | 99,9 | 1,95000 |
| 6924-ZZ | 120 | 165 | 22,0 | 53000 | 54000 | 3800 | 0 | 99,9 | 99,9 | 1,15000 |
| 6224-2RS | 120 | 215 | 40,0 | 155000 | 131000 | 0 | 0 | 99,9 | 99,9 | 5,15000 |
| 6224 | 120 | 215 | 40,0 | 155000 | 131000 | 2800 | 3400 | 99,9 | 99,9 | 5,15000 |
| 6924 | 120 | 165 | 22,0 | 53000 | 54000 | 3800 | 4400 | 99,9 | 99,9 | 1,15000 |
| 6324 | 120 | 260 | 55,0 | 212000 | 190000 | 2400 | 3000 | 99,9 | 99,9 | 13,60000 |
| 6024-2RS | 120 | 180 | 28,0 | 85000 | 79000 | 0 | 0 | 99,9 | 99,9 | 2,09000 |
| 6824 | 120 | 150 | 16,0 | 28900 | 33000 | 4000 | 4700 | 99,9 | 99,9 | 0,55500 |
| 6924-2RS | 120 | 165 | 22,0 | 53000 | 54000 | 0 | 0 | 99,9 | 99,9 | 1,15000 |
| 16024 | 120 | 180 | 19,0 | 63200 | 63300 | 3400 | 4000 | 99,9 | 99,9 | 1,70000 |
| 6824-2RS | 120 | 150 | 16,0 | 28900 | 33000 | 0 | 0 | 99,9 | 99,9 | 0,55500 |
| 6824-ZZ | 120 | 150 | 16,0 | 28900 | 33000 | 4000 | 0 | 99,9 | 99,9 | 0,55500 |
| 6024-ZZ | 120 | 180 | 28,0 | 85000 | 79000 | 3400 | 0 | 99,9 | 99,9 | 2,09000 |
| 6024 | 120 | 180 | 28,0 | 85000 | 79000 | 3400 | 4000 | 99,9 | 99,9 | 2,09000 |
| 6224-ZZ | 120 | 215 | 40,0 | 155000 | 131000 | 2800 | 0 | 99,9 | 99,9 | 5,15000 |
| 6226 | 130 | 230 | 40,0 | 167000 | 146000 | 2600 | 3100 | 99,9 | 99,9 | 6,00000 |
| 16026 | 130 | 200 | 22,0 | 79300 | 81000 | 3200 | 3800 | 99,9 | 99,9 | 2,50000 |
| 6326 | 130 | 280 | 58,0 | 229000 | 214000 | 2200 | 2800 | 99,9 | 99,9 | 17,00000 |
| 6926-2RS | 130 | 180 | 24,0 | 65000 | 67500 | 0 | 0 | 99,9 | 99,9 | 1,52000 |
| 6926 | 130 | 180 | 24,0 | 65000 | 67500 | 3500 | 4100 | 99,9 | 99,9 | 1,52000 |
| 6826-2RS | 130 | 165 | 18,0 | 37000 | 41000 | 0 | 0 | 99,9 | 99,9 | 0,80000 |
| 6026-ZZ | 130 | 200 | 33,0 | 106000 | 101000 | 3200 | 0 | 99,9 | 99,9 | 3,25000 |
| 6026-2RS | 130 | 200 | 33,0 | 106000 | 101000 | 0 | 0 | 99,9 | 99,9 | 3,25000 |
| 6826-ZZ | 130 | 165 | 18,0 | 37000 | 41000 | 3700 | 0 | 99,9 | 99,9 | 0,80000 |
| 6226-2RS | 130 | 230 | 40,0 | 167000 | 146000 | 0 | 0 | 99,9 | 99,9 | 6,00000 |
| 6226-ZZ | 130 | 230 | 40,0 | 167000 | 146000 | 2600 | 0 | 99,9 | 99,9 | 6,00000 |
| 6926-ZZ | 130 | 180 | 24,0 | 65000 | 67500 | 3500 | 0 | 99,9 | 99,9 | 1,52000 |
| 6026 | 130 | 200 | 33,0 | 106000 | 101000 | 3200 | 3800 | 99,9 | 99,9 | 3,25000 |
| 6826 | 130 | 165 | 18,0 | 37000 | 41000 | 3700 | 4300 | 99,9 | 99,9 | 0,80000 |
| 6828-2RS | 140 | 175 | 18,0 | 38500 | 44500 | 0 | 0 | 99,9 | 99,9 | 0,85000 |
| 6928 | 140 | 190 | 24,0 | 66500 | 71500 | 3200 | 3800 | 99,9 | 99,9 | 1,62000 |
| 6028 | 140 | 210 | 33,0 | 111000 | 109000 | 2800 | 3400 | 99,9 | 99,9 | 3,35000 |
| 6228 | 140 | 250 | 42,0 | 176000 | 164000 | 2400 | 3000 | 99,9 | 99,9 | 7,50000 |
| 16028 | 140 | 210 | 22,0 | 80600 | 86000 | 2800 | 3400 | 99,9 | 99,9 | 2,70000 |
| 6828 | 140 | 175 | 18,0 | 38500 | 44500 | 3400 | 4000 | 99,9 | 99,9 | 0,85000 |
| 6028-ZZ | 140 | 210 | 33,0 | 111000 | 109000 | 2800 | 0 | 99,9 | 99,9 | 3,35000 |
| 6928-ZZ | 140 | 190 | 24,0 | 66500 | 71500 | 3200 | 0 | 99,9 | 99,9 | 1,62000 |
| 6928-2RS | 140 | 190 | 24,0 | 66500 | 71500 | 0 | 0 | 99,9 | 99,9 | 1,62000 |
| 6828-ZZ | 140 | 175 | 18,0 | 38500 | 44500 | 3400 | 0 | 99,9 | 99,9 | 0,85000 |
| 6028-2RS | 140 | 210 | 33,0 | 111000 | 109000 | 0 | 0 | 99,9 | 99,9 | 3,35000 |
| 6328 | 140 | 300 | 62,0 | 255000 | 246000 | 2000 | 2600 | 99,9 | 99,9 | 21,00000 |
| 6030-ZZ | 150 | 225 | 35,0 | 125000 | 126000 | 2600 | 0 | 99,9 | 99,9 | 4,75000 |
| 6230 | 150 | 270 | 45,0 | 176000 | 170000 | 2000 | 2600 | 99,9 | 99,9 | 9,60000 |
| 6030-2RS | 150 | 225 | 35,0 | 125000 | 126000 | 0 | 0 | 99,9 | 99,9 | 4,75000 |
| 6830-2RS | 150 | 190 | 20,0 | 47500 | 55000 | 0 | 0 | 99,9 | 99,9 | 1,16000 |

Kugellager

| Kurz-Zeichen | Haupt-Abmessungen [mm] | | | Trag-Zahlen [N] | | Grenz-Drehzahlen [min-1] | | Anschluss-Maße [mm] | | Gewicht [kg] |
|--------------|------------------------|-----|------|-----------------|-----------|--------------------------|------|---------------------|--------|--------------|
| | d | D | B | dyn. Cr | stat. Cor | Fett | Öl | da min | Da max | |
| 6930-2RS | 150 | 210 | 28,0 | 85000 | 90500 | 0 | 0 | 99,9 | 99,9 | 2,47000 |
| 6930-ZZ | 150 | 210 | 28,0 | 85000 | 90500 | 3000 | 0 | 99,9 | 99,9 | 2,47000 |
| 6830 | 150 | 190 | 20,0 | 47500 | 55000 | 3100 | 3700 | 99,9 | 99,9 | 1,16000 |
| 6330 | 150 | 320 | 65,0 | 276000 | 284000 | 1900 | 2400 | 99,9 | 99,9 | 25,00000 |
| 6030 | 150 | 225 | 35,0 | 125000 | 126000 | 2600 | 3200 | 99,9 | 99,9 | 4,75000 |
| 6830-ZZ | 150 | 190 | 20,0 | 47500 | 55000 | 3100 | 0 | 99,9 | 99,9 | 1,16000 |
| 6930 | 150 | 210 | 28,0 | 85000 | 90500 | 3000 | 3500 | 99,9 | 99,9 | 2,47000 |
| 16030 | 150 | 225 | 24,0 | 92300 | 98000 | 2600 | 3200 | 99,9 | 99,9 | 3,40000 |
| 16032 | 160 | 240 | 25,0 | 99500 | 107000 | 2400 | 3000 | 99,9 | 99,9 | 3,60000 |
| 6932 | 160 | 220 | 28,0 | 87000 | 96000 | 2800 | 3300 | 99,9 | 99,9 | 2,61000 |
| 6032 | 160 | 240 | 38,0 | 140000 | 143000 | 2400 | 3000 | 99,9 | 99,9 | 5,85000 |
| 6832 | 160 | 200 | 20,0 | 48500 | 57000 | 2900 | 8400 | 99,9 | 99,9 | 1,32000 |
| 6232 | 160 | 290 | 48,0 | 185000 | 186000 | 1900 | 2400 | 99,9 | 99,9 | 15,00000 |
| 6234 | 170 | 310 | 52,0 | 212000 | 224000 | 1900 | 2400 | 99,9 | 99,9 | 17,50000 |
| 6834 | 170 | 215 | 22,0 | 60000 | 70500 | 2700 | 3200 | 99,9 | 99,9 | 1,63000 |
| 6934 | 170 | 230 | 28,0 | 86000 | 95500 | 2600 | 3100 | 99,9 | 99,9 | 2,74000 |
| 16034 | 170 | 260 | 28,0 | 119000 | 127000 | 2200 | 2800 | 99,9 | 99,9 | 5,70000 |
| 6034 | 170 | 260 | 42,0 | 168000 | 172000 | 2200 | 2800 | 99,9 | 99,9 | 7,80000 |
| 16036 | 180 | 280 | 31,0 | 140000 | 146000 | 2000 | 2600 | 99,9 | 99,9 | 7,00000 |
| 6236 | 180 | 320 | 52,0 | 227000 | 242000 | 1800 | 2200 | 99,9 | 99,9 | 18,50000 |
| 6836 | 180 | 225 | 22,0 | 60500 | 73000 | 2600 | 3000 | 99,9 | 99,9 | 2,03000 |
| 6036 | 180 | 280 | 46,0 | 186000 | 194000 | 2000 | 2600 | 99,9 | 99,9 | 10,50000 |
| 6936 | 180 | 250 | 33,0 | 110000 | 119000 | 2400 | 2900 | 99,9 | 99,9 | 4,76000 |
| 6238 | 190 | 340 | 55,0 | 255000 | 278000 | 1700 | 2000 | 99,9 | 99,9 | 23,00000 |
| 16038 | 190 | 290 | 31,0 | 148000 | 162000 | 2000 | 2600 | 99,9 | 99,9 | 7,90000 |
| 6838 | 190 | 240 | 24,0 | 73000 | 88000 | 2400 | 2900 | 99,9 | 99,9 | 2,62000 |
| 6938 | 190 | 260 | 33,0 | 113000 | 127000 | 2300 | 2700 | 99,9 | 99,9 | 4,98000 |
| 6038 | 190 | 290 | 46,0 | 195000 | 210000 | 2000 | 2600 | 99,9 | 99,9 | 11,00000 |
| 6940 | 200 | 280 | 38,0 | 157000 | 168000 | 2200 | 2600 | 99,9 | 99,9 | 7,10000 |
| 6040 | 200 | 310 | 51,0 | 208000 | 226000 | 1900 | 2400 | 99,9 | 99,9 | 13,09000 |
| 6840 | 200 | 250 | 24,0 | 74000 | 91500 | 2300 | 2700 | 99,9 | 99,9 | 2,73000 |
| 16040 | 200 | 310 | 34,0 | 168000 | 178000 | 1900 | 2400 | 99,9 | 99,9 | 9,00000 |
| 6240 | 200 | 360 | 58,0 | 280000 | 314000 | 1700 | 2000 | 99,9 | 99,9 | 28,00000 |
| 6944 | 220 | 300 | 38,0 | 160000 | 180000 | 2000 | 2300 | 99,9 | 99,9 | 7,69000 |
| 6244 | 220 | 400 | 65,0 | 311000 | 376000 | 1500 | 1800 | 99,9 | 99,9 | 37,00000 |
| 6044 | 220 | 340 | 56,0 | 277000 | 291000 | 1800 | 2200 | 99,9 | 99,9 | 19,00000 |
| 6844 | 220 | 270 | 24,0 | 76500 | 98000 | 2100 | 2400 | 99,9 | 99,9 | 3,00000 |
| 16044 | 220 | 340 | 37,0 | 191000 | 266000 | 1800 | 2200 | 99,9 | 99,9 | 12,00000 |
| 6048 | 240 | 360 | 56,0 | 247000 | 295000 | 1700 | 2000 | 99,9 | 99,9 | 19,50000 |
| 6848 | 240 | 300 | 28,0 | 98500 | 127000 | 1900 | 2200 | 99,9 | 99,9 | 4,60000 |
| 6948 | 240 | 320 | 38,0 | 170000 | 203000 | 1800 | 2100 | 99,9 | 99,9 | 8,26000 |
| 16048 | 240 | 360 | 37,0 | 181000 | 215000 | 1700 | 2000 | 99,9 | 99,9 | 14,00000 |
| 6248 | 240 | 440 | 72,0 | 360000 | 470000 | 1300 | 1600 | 99,9 | 99,9 | 51,00000 |